

9010 Multifunction Calibrator

user manual



Content

1. Introduction.....	6
1.1. Front panel overview.....	6
1.2. Rear panel overview.....	10
1.3. Options and accessories.....	10
1.4. Remote control.....	11
2. Getting started.....	12
2.1. Safety precautions.....	12
2.2. Power on and warm-up.....	13
2.3. Function setup.....	14
2.4. Signal output.....	14
3. Menu reference.....	15
3.1. Information menu.....	15
3.2. Device menu.....	16
3.3. System menu.....	16
3.4. Interface menu.....	16
3.5. Calibration menu.....	17
3.6. Preset menu.....	17
4. Calibration examples.....	18
4.1. AC/DC Voltage.....	18
4.2. AC/DC Current.....	22
4.3. Resistance.....	24
4.4. Capacitance.....	27
4.5. Electric power meters, analyzers and energy meters.....	28
4.6. SCO scope extension.....	31
4.7. Temperature sensor simulation.....	34
4.8. MER multimeter extension.....	36
5. Performance verification.....	40
5.1. Required equipment.....	40
5.2. Verification procedure.....	40
5.3. Test points.....	41
6. Adjustment.....	45
6.1. Calibration menu structure.....	45
6.2. Calibration point adjustment.....	46
6.3. List of calibration points.....	47
7. Maintenance.....	51
7.1. Fuse replacement.....	51
7.2. External surface cleaning.....	51
7.3. Firmware update.....	51
7.4. Error messages.....	52
8. Specifications.....	53
8.1. Voltage.....	54
8.2. Current.....	56

8.3.	Resistance.....	58
8.4.	Capacitance	60
8.5.	Power and energy	61
8.6.	Harmonics	63
8.7.	Temperature sensor simulation.....	63
8.8.	SCO 400 MHz scope option.....	65
8.9.	MER integrated multimeter option.....	67

Certificate of conformity	69
--	-----------

List of tables

Table 1 Integrated options	11
Table 2 Scope option modes	31
Table 3 Multimeter SETUP	39
Table 4 List of main test points	43
Table 5 List of options' test points.....	44
Table 6 Calibration points – DC voltage and current	47
Table 7 Calibration points – AC voltage and current.....	48
Table 8 Calibration points – Resistance	49
Table 9 Calibration points – Capacitance	49
Table 10 Calibration points – HVR option	50
Table 11 Calibration points – SCO option.....	50
Table 12 Calibration points – MER option	50
Table 13 Error code overview	52

List of figures

Figure 1 Front panel	6
Figure 2 Input/output terminals.....	7
Figure 3 Display	8
Figure 4 Softkeys and menu buttons.....	9
Figure 5 Function buttons.....	9
Figure 6 Rear panel	10
Figure 7 Starting Screen	13
Figure 8 Factory default screen	13
Figure 9 Main and auxiliary parameters.....	14
Figure 10 Main menu	15
Figure 11 Device/Setup menu	16
Figure 12 Preset function.....	17
Figure 13 Voltmeter calibration.....	18
Figure 14 Harmonic products setting.....	19
Figure 15 Signal preview	19
Figure 16 List of preset waveforms	20
Figure 17 Voltage SETUP screen	21
Figure 18 Ammeter calibration	22
Figure 19 Current SETUP screen	23
Figure 20 Two-wire resistance calibration.....	24
Figure 21 Four-wire resistance calibration.....	25
Figure 22 High resistance calibration	26

Figure 23 Capacitance calibration.....	27
Figure 24 AC Power	28
Figure 25 Power meter calibration.....	28
Figure 26 Harmonic mode.....	29
Figure 27 Energy mode.....	29
Figure 28 Power/Energy soft keys.....	30
Figure 29 Energy mode.....	30
Figure 30 Scope option.....	31
Figure 31 SCO option Device/Setup menu.....	33
Figure 32 RTD temperature sensor simulation	34
Figure 33 TC temperature sensor simulation.....	35
Figure 34 TC External cold junction compensation using Adapter 91	35
Figure 35 Process multimeter	36
Figure 36 Thermocouple output through 91 Adapter	36
Figure 37 Multimeter softkeys.....	37
Figure 38 Meter smoothing filter.....	37
Figure 39 Meter statistics function.....	38
Figure 40 Meter limits function.....	38
Figure 41 Password entry.....	45
Figure 42 Calibration menu with out-of-date calibration data	45
Figure 43 Calibration point adjustment – direct.....	46
Figure 44 Calibration point adjustment – indirect.....	46

1. Introduction

Multifunction calibrator 9010 is designed as universal calibration tool for electrical calibration laboratories, covering most of their workload like multimeters, clamp meters, ohm meters, power meters and power analysers, energy meters, transducers, insulation testers, process meters, scopes and many others. High load capacity of voltage output (up to 50 mA) allows for calibration of high-consumption analogue meters. Installed harmonic and non-harmonic shape signals allow for testing meter sensitivity to distorted signals by a signal with various crest factor.

Advancing from previous M14x calibrator series, 9010 can now calibrate even 400 MHz scopes, 1.5 kV insulation testers and 1 MW power meters. On the other hand we kept all the popular functions including complete transducer and external sensor calibration (strain gauge, pressure, torsion, force, etc.) using built-in multimeter, automatic uncertainty calculation, remote control and easy recalibration.

1.1. Front panel overview

Main control segments of the calibrator (Figure 3) are:

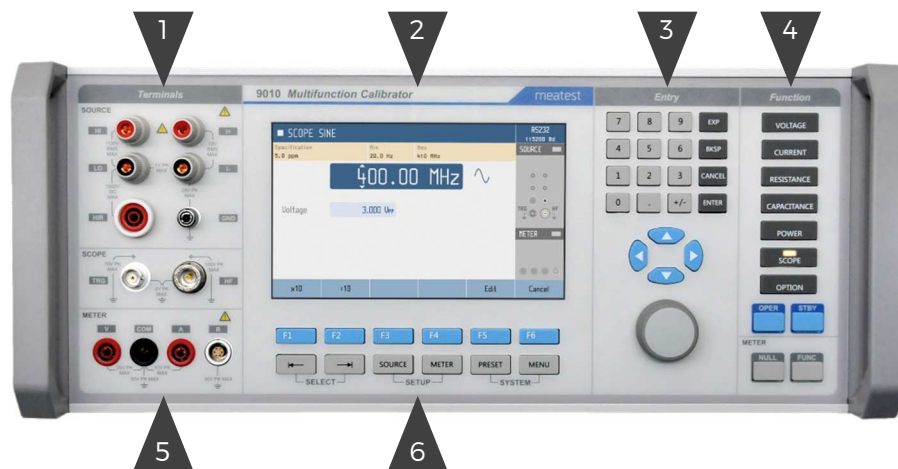


Figure 1 Front panel

1. Output terminals
2. Display
3. Numeric and navigation keys
4. Function keys
5. Input terminals
6. Softkeys (sky blue) and menu keys (grey)

1.1.1. Terminals in detail

All input and output terminals are located on left side of front panel. Labels between terminals show overall maximum voltage ratings in standby. Maximum voltage ratings during operation are usually lower and exceeding them might cause damage to the calibrator! See Specifications for detailed ratings.

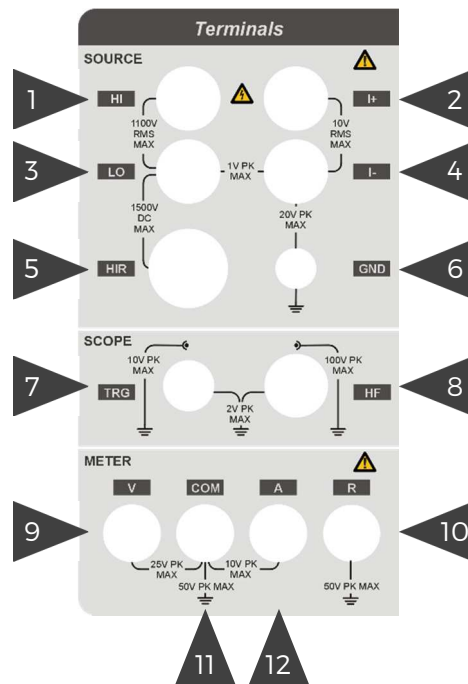


Figure 2 Input/output terminals

1. HI. Outputs set voltage in VOLTAGE and POWER functions, set resistance in 2W mode of RESISTANCE and CAPACITANCE functions and force signal in 4W RESISTANCE mode. All signals are relative to LO.
2. I+. Outputs set current in CURRENT and POWER functions and senses RESISTANCE in 4W mode. All signals are relative to I-. Current output is protected with 32A fuse on the rear panel, see chapter 1.2, item 6.
3. LO. Acts as zero potential in VOLTAGE, POWER, 2W RESISTANCE, 2W CAPACITANCE and HVR functions. Also provides zero potential to force signal in 4W RESISTANCE mode.
4. I-. Acts as zero potential in CURRENT and POWER functions. Also provides zero potential to sense signal in 4W RESISTANCE mode. I- terminal is floating up to 20 V_{pk} relative to the Ground, SETUP menu allows you to ground this terminal with relay.
5. HIR. Outputs set resistance in HVR function (option HVR).
6. GND. Ground potential, galvanically connected with housing and mains PE wire.
7. TRG. Used as external trigger for SCOPE functions (option SCO).
8. SCO. Outputs all SCOPE function signals through N-type coaxial connector (option SCO).
9. V. Measures voltage and frequency signals in METER function, relative to COM (option MER).
10. COM. Acts as zero potential for all METER functions (option MER).
11. A. Measures current signals in METER function, relative to COM (option MER).
12. R. Connector for 9000-60 Adapter and 91 Cold Junction Compensator only, don't connect any other cables to this terminal! 9000-60 adapter is used for measurement of RTDs and 4W resistance in METER function (option MER), 91 adapter is used for cold junction compensation of thermocouples. Adapter terminals are described on the adapters themselves.

1.1.2. Display in detail

Display is divided into several sections with following meaning:

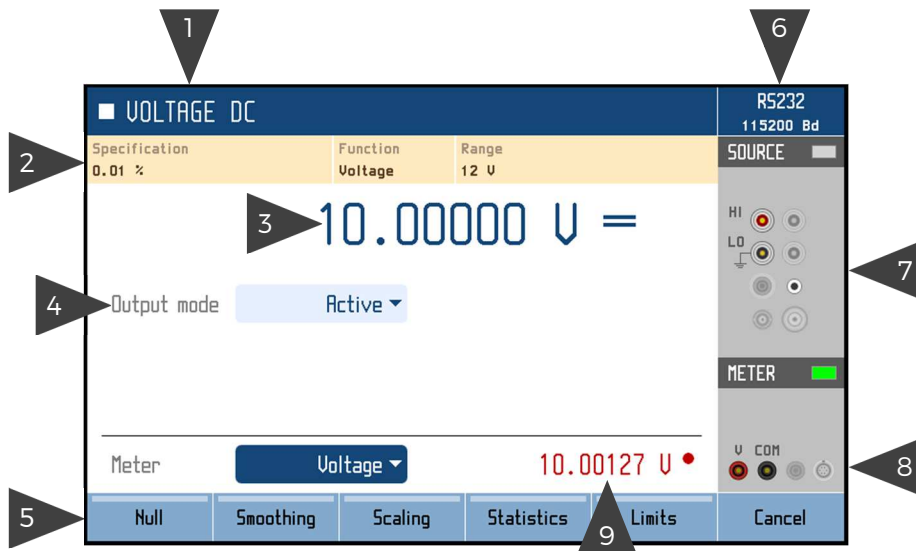


Figure 3 Display

1. Selected function. Symbol on the left indicates system status (■ standby, ∪ settling in, ► running). There may be additional Warning symbols on the right:
 - a. Warm-up in progress. Calibrator is fully operational but it may be outside specifications.
 - b. Overheated. Output terminals cannot be switched on until temperature falls below safe limit. Set 10V DC and wait a few minutes until the symbol disappears.
 - c. Other error. Some functions may not be operational and/or outside specifications. Go to “MENU/Information/Device status” to get detailed information.
2. Tooltip. Shows additional information about selected parameter or main value. Information may include uncertainty, range, description, limits (burden current, compliance voltage), etc. Tooltip is hidden when no parameter is selected.
3. Main value. Can be edited via numerical input, cursor keys or rotary knob. Symbol on the right represents signal shape.
4. Auxiliary parameters. You can switch between parameters (and main value) using ◀ and ▶ buttons. Every function has different set of auxiliary parameters.
5. Softkey labels. Softkeys below the display change their function dynamically based on current workspace, these labels describe Softkey functions at any given time.
6. Remote control. Shows active interface and its main parameter.
7. Output status. Indicates output status (grey means OFF, green means ON) and shows diagram of active output terminals.
8. Input status. Indicates meter status (grey means disconnected, green means measuring) and shows diagram of active input terminals.
9. Meter reading. Meter function can be changed using FUNC button in METER group.

1.1.3. Keys in detail

There are 3 button groups in total on the front panel. Softkeys and menu buttons under the display, function buttons on the right and numeric entry buttons with rotary knob and cursor buttons in between.

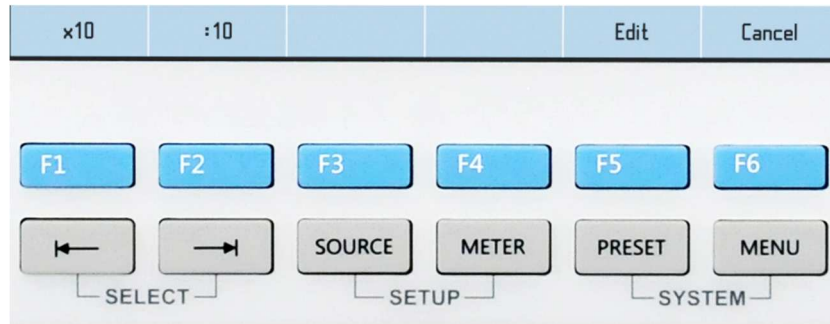


Figure 4 Softkeys and menu buttons

1. **SELECT.** Selects previous/next parameter on display. Selected parameter can be edited and relevant tooltip is shown (if enabled). Press CANCEL to deselect a parameter.
2. **SETUP.** Enters/exits device menu. Device menu contains additional function parameters, see chapter 3.2 or SETUP subchapters in chapter 4 for more details.
3. **SYSTEM.** Enters/exits main menu. Main menu contains all device-related settings, see menu structure in chapter 3.
4. **Softkeys.** Buttons with context-specific functions. Current functions are shown on display, just above the buttons.

Entry buttons

1. **Function buttons.** Directly selects a calibrator function or toggles function mode if the function is already selected (f.e. pushing VOLTAGE button in voltage DC mode switches to voltage AC mode).
2. **OPER.** Turns output on according to selected function and parameters.
3. **STBY.** Turns output off.
4. **NULL.** Sets meter readout to zero by shifting offset of active meter function.
5. **FUNC.** Toggles meter function.



Figure 5 Function buttons

Entry buttons

Numeric and navigation buttons have dual function. In menus these buttons are used to list through items (▲ and ▼ buttons, knob rotation), select an item (ENTER button, OK softkey or knob push), enter a value or exit menu item (CANCEL button, EXIT/CLOSE softkey).

Outside menus, numeric and navigation buttons are used to edit values of selected parameters. If no parameter is selected, pressing any numeric or navigation button will select function's main parameter. Values can be edited with cursor keys and rotary knob as well. Use ◀ and ▶ buttons to shift through digits and ▲ and ▼ buttons to increment or decrement that digit. Knob rotation works as either ▲ / ▼ or ◀ / ▶ buttons, knob push toggles between the two modes.

1.2. Rear panel overview

There is located power line entry module with power line fuse, power line voltage selector 115/230V and power line switch. On the bottom side interface connectors RS-232, SPS and optionally LAN, USB and IEEE488 on the rear panel.

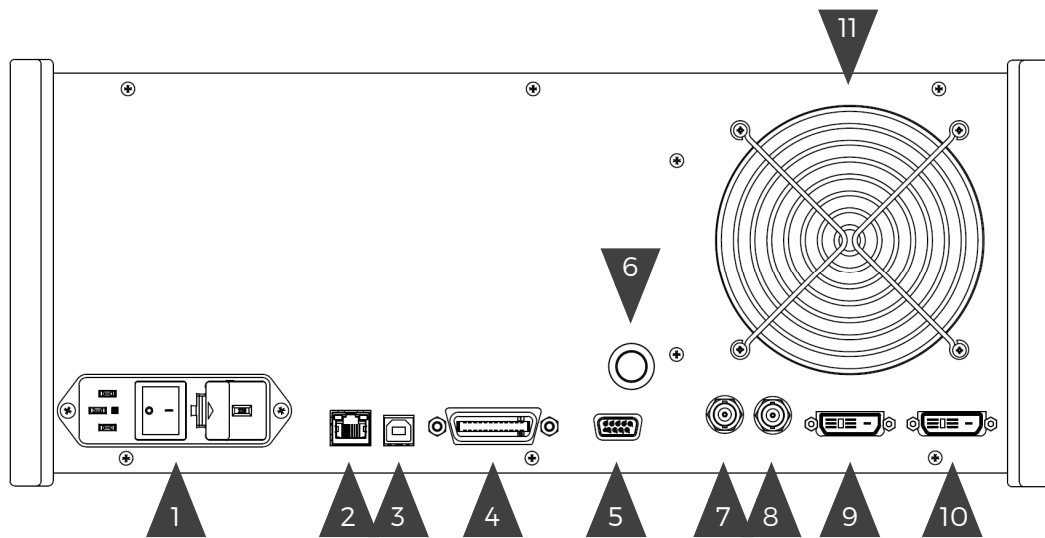


Figure 6 Rear panel

1. Power cord module with power switch, fuse holder and 115/230 V voltage selector
2. RJ-45 (Ethernet) connector for remote control
3. USB connector for remote control
4. GPIB IEEE-488 connector for remote control
5. RS-232 connector
6. Current output fuse holder
7. External signal synchronization input
8. External signal synchronization output
9. SPS connector A for external calibrator modules
10. SPS connector B for external calibrator modules
11. Fan outlet cover

1.3. Options and accessories

Every 9010 Multifunction Calibrator delivery includes following items:

- USB stick with user manual
- Factory calibration certificate
- Power cord (with European E-type plug, feel free to ask for other types when ordering)
- 3x spare fuse (3.15A, 6.3A, 35A)
- RS232 cable
- Test leads, rated for 600V/32A

Following accessory is not part of standard delivery and can be extra ordered:

- Option 91 Pt100 Cold junction compensator
- ISO17025 calibration certificate
- 3, 4 or 5-year extended warranty

9010 Multifunction calibrator can be ordered with integrated options as listed in Table 1. Integrated options can be fitted only by manufacturer and certified service providers.

Option	Description	Additional accessory
SCO	Scope extension for calibration of oscilloscopes up to 400 MHz.	N/BNC Coaxial adapter
HVR	High voltage resistance extension for calibration of insulation testers on megaohmmeters up to 1.5 kV.	191-11 Cable for HV measurement up to 5 kV
MER	Multimeter extension for calibration of transducers and simulation of strain gauges and other industrial sensors.	9000-60 Cable adapter for R4W/RTD measurement

Table 1 Integrated options

1.4. Remote control

The calibrator can be integrated into automated calibration systems (ATS) and generally controlled from remote computer via following remote control interfaces:

- RS232
- USB
- GPIB (IEEE488)
- LAN

When controlled remotely, maximum ratings of calibrator's output signals as well as all other specifications are the same as in manual mode.

Meatest software package WinQbase + Caliber is recommended for best automation results. This system is designed for automated and semi automated calibrations of digital and analogue meters including uncertainty calculation, result evaluation and certificate printing according to ISO 17025 standard.

1.4.1. Connection setup

Only one interface can be used for communication at any given time. Default active interface is RS232, other interfaces can be selected in MENU->Interface->Active bus. To establish connection between the calibrator and computer, set interface settings in your computer accordingly:

RS232 and USB connection settings

- COM port see available COM ports in Windows Device Manager
- Baudrate USB 9600
- Baudrate RS232 according to MENU->Interface->RS232 Baudrate (9600 by default)
- Data bits 8
- Stop bits 1
- Parity None
- Handshake (XON/XOFF) Off

GPIB connection settings

- GPIB Address according to MENU->Interface->GPIB Address (2 by default)

LAN connection settings

DHCP service discovery is active by default and is recommended for easiest connection. If you prefer to use fixed IP address or change any other default settings, go to MENU->Interface->LAN Settings.

LAN communication uses Telnet protocol. Default log-in for Telnet client is "9010_SNxxxxxx 23", where "xxxxxx" stands for serial number and 23 is default communication port.

1.4.2. SCPI commands and protocol

See 9010 SCPI manual for complete SCPI reference, more details on communication setup and troubleshooting.

2. Getting started

Inspect package contents when unboxing the calibrator for the first time. See chapter 1.3 for complete list of accessories.

Place the instrument on a level surface before powering on and let it stabilize for at least one hour if the instrument has been stored outside of reference temperatures beforehand.

2.1. Safety precautions

The instrument has been designed according to IEC 61010-1:2011 + A1. Safety is ensured by design and by use of specific components. The manufacturer is not liable for the damage caused by modification of the construction or replacement of parts with non-original ones.

Safety symbols used on the equipment:



Warning, risk of danger.



Warning - risk of electric shock. Hazardous voltage above 50 V DC or AC might be present.



See User Manual.



Protective earth.



Fuse.

To prevent possible electrical shock or personal injury:

- Read carefully safety information before you use the Product.
- Do not alter the Product and use only as specified, or the protection supplied by the Product can be compromised.
- Do not use the Product if it is altered or damaged.
- Use this Product indoors only.
- Use power cord approved for local mains voltage and plug configuration and rated for the Product.
- Use test leads rated for at least 1000 V and 20 A in all core functions and at least 2000 V in HVR high voltage resistance function.
- Keep hands away from all Product terminals and exposed metal cable parts during operation. High voltage on those may cause death or serious injury.

2.2. Power on and warm-up

The calibrator must be powered by 230/115 V – 50/60 Hz mains. Before connecting the instrument to the mains, check the position of the mains voltage selector located on the rear panel. Set appropriate voltage selector position either 115 V or 230 V.

Plug one end of the power cord into connector on the rear panel and connect the other end of the power cord into a wall outlet. Turn the calibrator on with mains switch right next to it. You should see following splash screen on display.

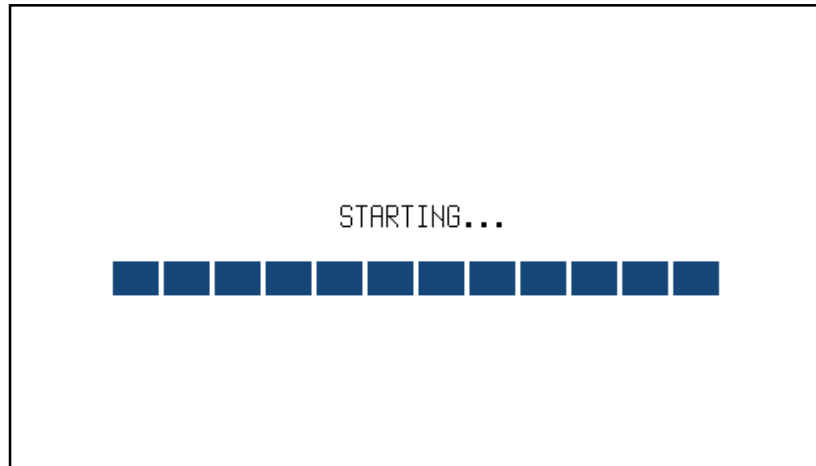


Figure 7 Starting Screen

Calibrator then performs internal hardware checks for app. 5 seconds and then starts in Startup state (called Preset). Startup preset can be customized and up to 99 other presets can be defined and recalled later at any time. By default the Startup preset is set to VDC function, 10 V with output switched off.

Warm-up

Specified parameters are guaranteed 30 minutes after switching the calibrator on and stabilizing it in reference conditions.

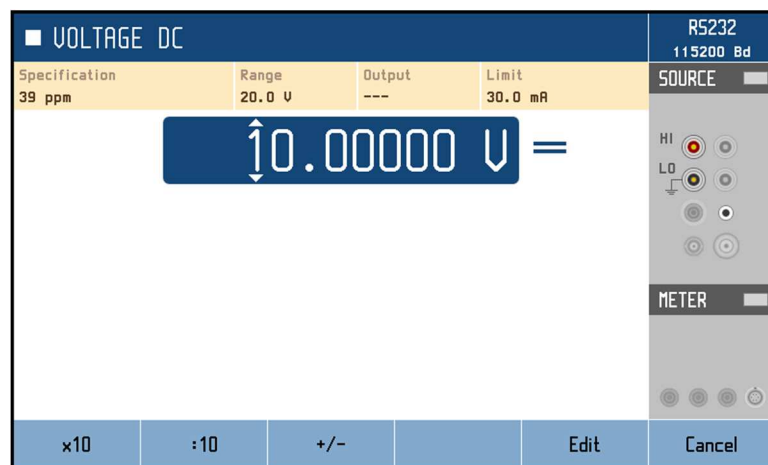


Figure 8 Factory default screen

2.3. Function setup

Calibrator output (source) function can be set using FUNCTION buttons. Push any FUNCTION button to change function or push the button repeatedly to scroll through function modes if available (for example DC and AC in voltage function).

Once a function is selected, you can change the main value as well as auxiliary output parameters like frequency in AC modes or phase shift in AC power function. Function parameters can be edited in three ways:

- Numeric keypad. Write a value directly and confirm either by softkey with appropriate unit or ENTER button to set value in base unit (for example V).
- Cursor keys and rotary button. Push ▲▼ buttons or turn rotary knob to increment/decrement selected digit by one. Move through parameter digits using ◀▶ buttons or push the rotary knob to switch to digit selection mode, rotate to a new digit and confirm with another push.
- Softkeys. Values of most parameters can be also changed by softkeys x10 and :10, which change value by order of magnitude and +/- softkey which switches polarity.

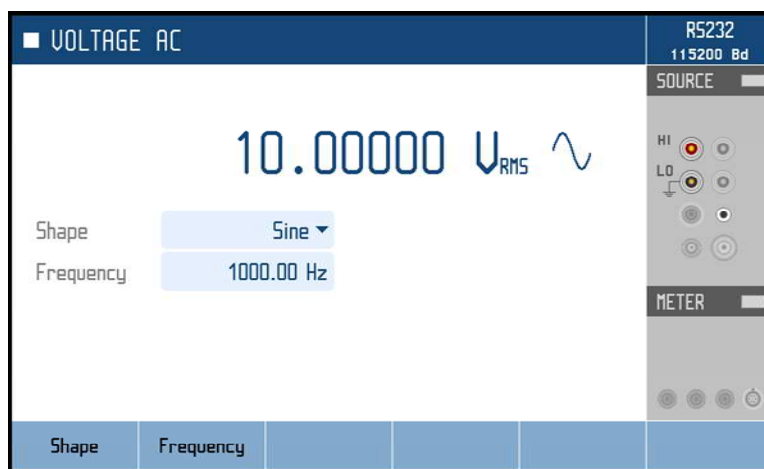


Figure 9 Main and auxiliary parameters

Described methods change the main parameter by default. If there are any other parameters on display, you can switch between them using ← and → select buttons. Picture above shows AC voltage function with main value 10 V_{rms} and two auxiliary parameters: signal shape and frequency. Both auxiliary parameters have their dedicated softkey for fast access.

Additional settings are available under setup buttons SOURCE and METER. These buttons are shortcuts to relevant sections of Device menu. See chapter 3.2 or SETUP subchapters in chapter 4 for more details.

2.4. Signal output

Calibrator output can be turned on by pushing OPER button. STBY button turns output off. Output turns off automatically on calibrator startup and function switch. Output state is indicated by LED light in OPER button as well as green rectangle next to Source label on the right side of the display. Diagram below Source label shows which terminals are currently being used.

Signal input

With MER option installed you can also take advantage of integrated multimeter and its measurement capabilities. Meter input can be activated and deactivated by pushing FUNC button. Similarly to calibrator output, meter input state is indicated by LED light in FUNC button and green rectangle next to Meter label.

3. Menu reference

Four buttons on the front panel give access to main menu sections:

- Source. Shortcut to section of Menu > Device related to currently selected source function.
- Meter. Shortcut to Menu > Device > Meter
- Preset. Save or recall predefined calibrator configurations. See chapter 3.6 for more details.
- Menu. Access to main menu.

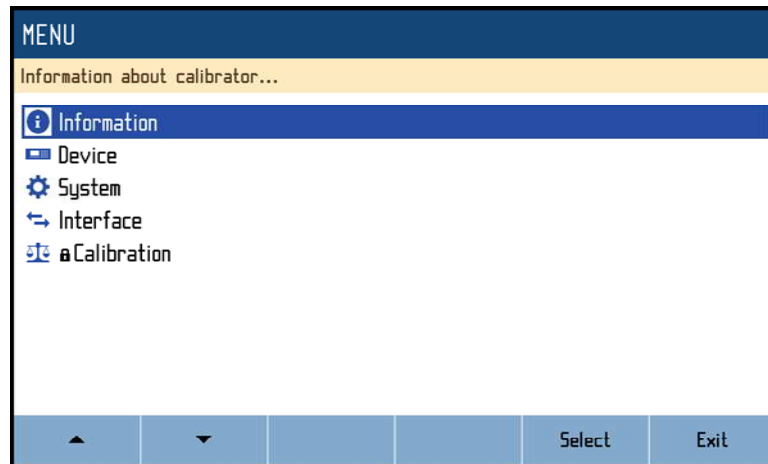


Figure 10 Main menu

Main menu is the most comprehensive setup tool of the calibrator, containing information like serial number, calibration date or display brightness as well as remote control interface setup or calibration constants.

Short tooltip in yellow box shows basic description of selected item. Main menu items are described in detail in chapters 3.1 – 3.5.

3.1. Information menu

Information menu contains general device data which cannot be modified by the user:

<ul style="list-style-type: none">- Manufacturer- Model- Serial number	Device identification
<ul style="list-style-type: none">- Software version- Hardware version- Option installed	Device configuration
<ul style="list-style-type: none">- Expiration of Calibration validity- Current date- Device status	Device readiness info. Calibration expiration date is equal to last calibration date plus calibration interval, see menu item Calibration for more details.
<ul style="list-style-type: none">- Testing tools	Display and keyboard diagnostics
<ul style="list-style-type: none">- Modules	List of internal electronic modules and their status

3.2. Device menu

Device menu is divided into sections based on calibrator functions and gives access to additional function related settings. Sections of currently used source and meter functions can be accessed directly using SOURCE and METER shortcut buttons on front panel. Picture below shows DC power section as an example of device menu.

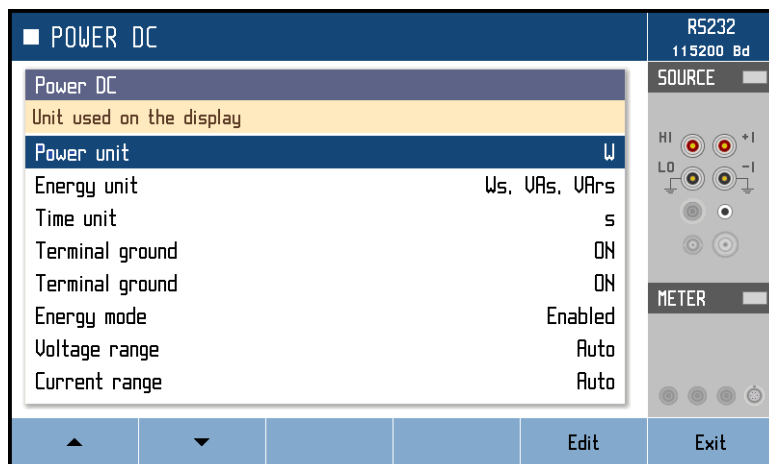


Figure 11 Device/Setup menu

3.3. System menu

System menu contains general, user-accessible device settings:

- Language Language version of user interface
- Display backlight [0 – 100 %]
- Button light intensity [0 – 100 %]
- Beeper volume [0 – 100 %]
- Keyboard beep [On/Off]
- Show tooltips on display Turns yellow menu tooltip On/Off
- Form of specification [Auto/Absolute/%/ppm]
- Date & Time Password protected submenu with following items
 - o Time System time in HH:MM:SS format
 - o Date System date in selected format
 - o Format Date format [M/D/Y, M-D-Y, D/M/Y, D.M.Y, D-M-Y, Y/M/D, Y.M.D]
 - o Show date & time on display [On/Off]

3.4. Interface menu

Interface menu contains remote control connection settings:

Menu item	Range / format	Default value
Active bus	RS232/GPIB/USB/LAN	RS232
RS232 Baudrate	1200 – 115200	9600
GPIB Address	0 – 31	2
LAN Settings		
> DHCP	On/Off	On
> IP Address	IPv4 format; locked with DHCP On	192.168.001.100
> Subnet mask	IPv4 format; locked with DHCP On	255.255.255.000
> Default gateway	IPv4 format; locked with DHCP On	255.255.255.255
> Port number	0 – 9999	23
> Host name	14 alphanumeric characters; locked with DHCP Off	M160_SN710011

3.5. Calibration menu

Calibration menu contains internal calibration constants and other tools for device adjustment and is therefore password protected. See chapter 6 for more details on 9010 adjustment. Calibration menu has following items:

1. Data. Contains current calibration data. Structure of this menu is described in chapter 6.1.
2. Backup. Calibration data backup. See below for more details.
3. Password. Changes calibration password. Calibration password gives access to Calibration menu and Date/Time settings in Information menu.
4. Calibration date. Calibration date is updated automatically upon calibration data adjustment or just by manual confirmation (if calibration doesn't require adjustment).
5. Calibration interval. Recommended interval is 12 months.

Backup function allows you to save and recall entire sets of calibration data. Calibration data are also saved automatically when any calibration value gets changed, creating a record with "Auto" storage (or overwriting an existing one if the last change occurred within last 90 days). Use softkeys to save and recall previously stored calibration data sets:

1. Back up. Saves currently used calibration data, overwriting existing record on selected Location. Only empty records and records with Calibration access and Manual storage can be overwritten.
2. Try. Loads selected record temporarily, original calibration data will be restored on next calibrator startup.
3. Load. Loads selected record permanently.
4. Delete. Deletes record. Only records with Calibration access and Manual storage can be deleted.

3.6. Preset menu

Preset feature allows you to save and recall one of up to 100 calibrator configurations so that you can get to work quickly instead of setting up the calibrator every single time. Push PRESET button to show list of saved presets:

PRESETS					
Location	Preset	Function	Date		
00	Startup	Power AC	08/29/2018		
01	---	---	---		
02	---	---	---		
03	---	---	---		
04	---	---	---		
05	---	---	---		
06	---	---	---		
07	---	---	---		
08	---	---	---		
09	---	---	---		
10	---	---	---		
▼					
Save	Load	Clear	Page Up	Page Down	Close

Figure 12 Preset function

To recall a predefined configuration, select its preset the list a push Load softkey. Configuration will be loaded with output turned off for safety reasons.

Similarly you can save a configuration by choosing Location 0 – 99 from the list and pushing Save softkey. Preset includes configuration of:

- Function and mode (for example AC Power)
- Main value (for example 10 VA)
- Auxiliary parameters (for example 50 Hz, 10 V, 1 A, 0 °)
- Additional Device/Setup menu parameters of current Source and Meter function

Preset doesn't include harmonic distortion parameters nor main menu settings except those mentioned above.

4. Calibration examples

4.1. AC/DC Voltage

4.1.1. DC and SINE Voltage

1. Connect the voltmeter to the calibrator as shown on the figure below.
2. Select appropriate function and range on the voltmeter
3. Push VOLTAGE function key on the calibrator. DC mode is automatically set. Push VOLTAGE key once more if AC voltage is requested.

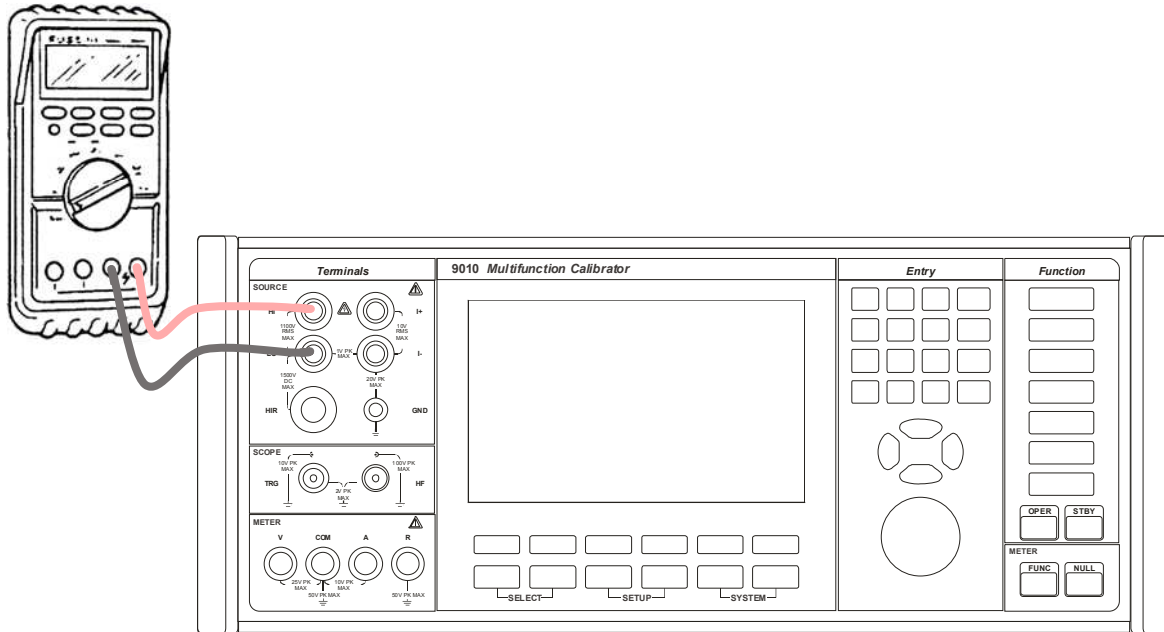


Figure 13 Voltmeter calibration

4. In AC mode push SELECT function repeatedly to activate window Frequency and set requested frequency.
5. Set output voltage value using cursor keys, rotary button or numerical keyboard.
6. Switch output terminals on by pushing key OPER. Output voltage is presented on the output terminals, OPER key is lit and indication SOURCE on the screen is green.
7. Push STBY key to switch output voltage off.

4.1.2. Non-sinusoidal Voltage

Calibrator can source non-sinusoidal waveforms with pre-defined shape. Frequency range for these waveforms is limited from 10 mV to 200 V and frequency range from 40 Hz to 1 kHz. Following waveforms are implemented:

- Limit. Sine sinusoidal with defined distortion 13.22 %
- Square squarewave symmetrical
- Triangle symmetrical
- Ramp Up
- Ramp Down
- Harmonic adjustable harmonic products

To select requested waveform push the soft key SHAPE, highlight requested item using softkeys ▲▼, cursor keys or rotary button and confirm with ENTER.

4.1.3. Harmonic

Calibrator has unique feature of creation by customer defined output AC signal. Definition on the signal is based on setting of amplitude and phase shift of harmonic products related to basic, fundamental frequency. Number of harmonic products is limited to 50 but maximum frequency of harmonic product cannot exceed 5 kHz. Amplitude of individual harmonic products cannot be higher than 10 % of amplitude of fundament signal.

Harmonic product editing

1. Push the key SELECT to make active window Harmonic.
2. Push the EDIT soft key. Table with list of harmonic products appears. Set amplitude and phase of requested harmonic product. Use key SELECT to move active window between Amplitude and Phase.
3. When all harmonic products are set push soft key EXIT to return back to basic screen. Distortion of sine wave signal has been adjusted.

HARMONIC ADJUSTMENT > VOLTAGE > *Dist 10		
Harmonic	Amplitude	Phase
01	100.000 %	0.00 °
* 02	20.000 %	0.00 °
* 03	15.000 %	0.00 °
* 04	12.000 %	0.00 °
* 05	10.000 %	0.00 °
* 06	8.000 %	0.00 °
* 07	7.000 %	0.00 °
* 08	6.000 %	0.00 °
* 09	5.000 %	0.00 °
* 10	4.000 %	0.00 °
* 11	3.000 %	0.00 °
* 12	2.000 %	0.00 °
* 13	1.000 %	0.00 °
* 14	0.000 %	0.00 °
* 15	0.000 %	0.00 °
* 16	0.000 %	0.00 °
→ * Edit Clear All Page Up Page Down Exit		

Figure 14 Harmonic products setting

To reset all harmonic products setting use soft key CLEAR ALL. All higher harmonic products are set to zero except fundamental component. When non-zero distortion is set, star sign will appear in window Harmonic ahead Sine label.

To move between pages of harmonic products use soft keys PAGE UP and PAGE DOWN.

Signal preview

The formed signal can be displayed either in frequency or time domain.

Push the soft key Bar to display relative level of harmonic products setting in frequency domain. Fundamental component is displayed in yellow, higher harmonics in red colour.

Push the soft key PREVIEW to see the signal waveform in time domain.

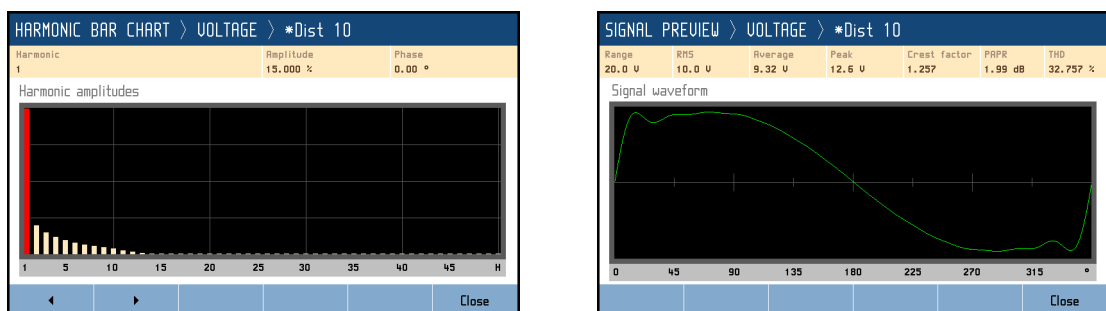


Figure 15 Signal preview

Any adjusted signal can be stored in the calibrator memory for later use. Use the NEW soft key to create a new signal name. Use rotary button to select individual signs (numbers or letters) and confirm with SAVE when finished.

HARMONIC PRESET > VOLTAGE	
Preset	Date
Sine	01/01/2016
Dist 10	12/24/2055
<div> <div>New</div> <div>Save</div> <div>Load</div> <div>Delete</div> <div></div> <div>Close</div> </div>	

4.1.4. Passive and Active Output

Active output is formed by electronic amplifier. The output offers higher load current up to 5 mA however with a little bit worse uncertainty. Passive mode is formed by resistance divider with output resistance 50 Ω . Output signal is less noisy and with better uncertainty however maximal output current is given by its output impedance. See specification for detailed differences.

Meatest 9010 User Manual

4.1.5. Voltage SETUP

Voltage function SETUP can be activated using SETUP SOURCE key. Following screen will appear:

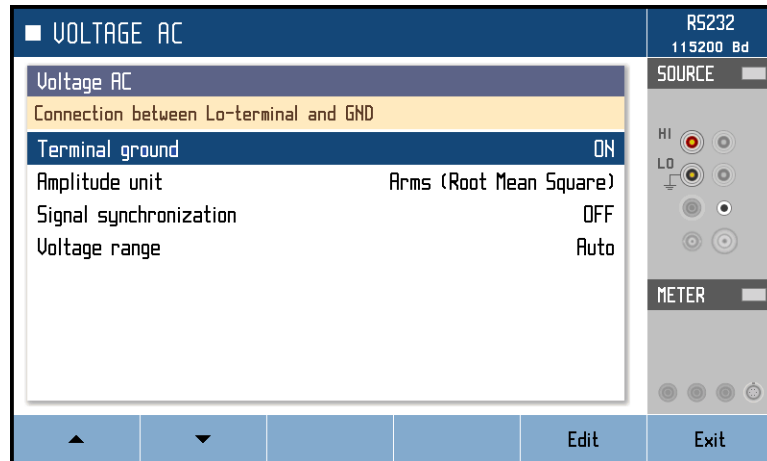


Figure 17 Voltage SETUP screen

SETUP offers additional setting of voltage function. Use ▲▼ keys and EDIT soft key to change setting.

Voltage DC

- Terminal ground: On/Off
LO voltage output terminals is internally connected to PE wire when ON. Voltage output is floating when OFF. Symbol of ground is displayed in terminal field on screen when ON item is selected.
- Output mode: Active/Passive
Selection if active or passive output is used in range 20 mV and 200 mV. Active output is less accurate but offers higher load current. Passive output is more accurate but output resistance is 50 Ω . See specification for details.
- Voltage range: Auto/20mV/200mV/2V/100V/280V/1000V
In AUTO setting internal ranges are automatically switched to offer the lowest uncertainty. Any internal range 20 mV to 1000 V can be fixed.

Voltage AC

- Terminal ground: On/Off
LO voltage output terminals is internally connected to PE wire when ON. Voltage output is floating when OFF. Symbol of ground is displayed in terminal field on screen when ON item is selected.
- Voltage unit: root mean square, peak, peak-peak, average
Parameter enables selection of type of unit displays on the display.
- Signal synchronization:
 - o Internal: frequency and phase is given by internal oscillator
 - o Power Line: synchronized to power line voltage
 - o BNC: synchronized to the signal input BNC TRG connector
 - o External Master: rear panel BNC Master connector synchronization
- Phase shift: x.xxx °
The parameter offers setting of phase shift between output voltage and synchronization signal (available for Power line / BNC / External Master)
- Voltage range: Auto/20mV/200mV/2V/100V/280V/1000V
In AUTO setting internal ranges are automatically switched to offer the lowest uncertainty. Any internal range 20 mV to 1000 V can be fixed.

4.2. AC/DC Current

4.2.1. DC and SINE Current

1. Connect the ammeter to the calibrator as shown on the figure below.
2. Select appropriate function and range on the ammeter (multimeter)
3. Push CURRENT function key on the calibrator. DC mode is automatically set. Push CURRENT key once more if AC current is requested.

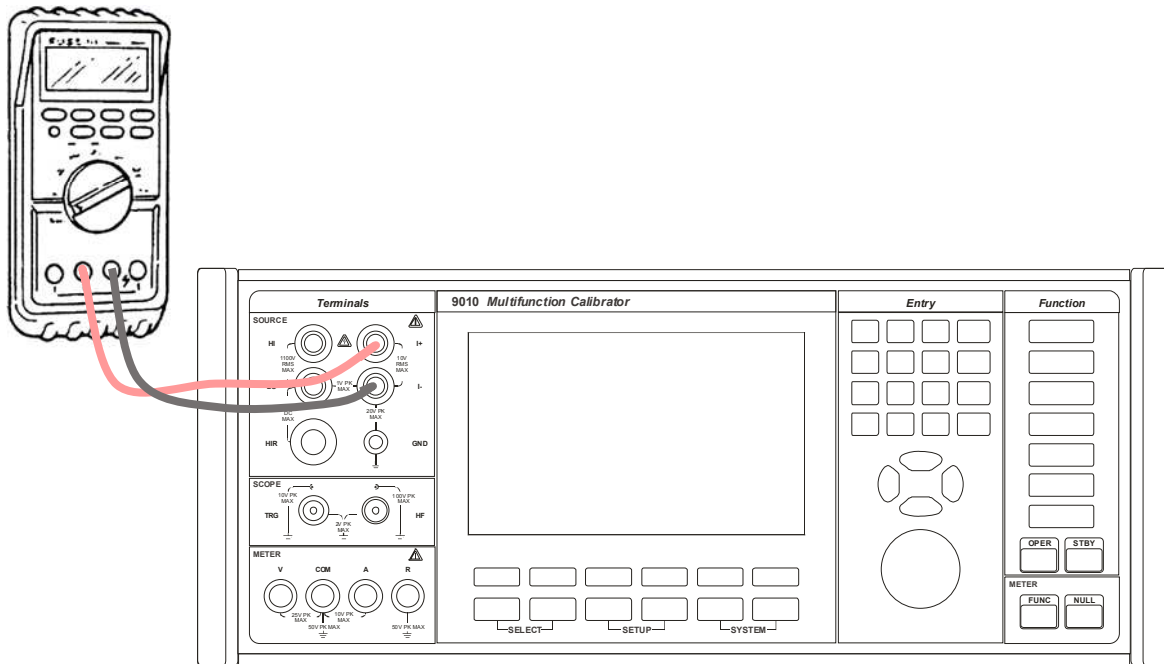


Figure 18 Ammeter calibration

4. In AC mode push SELECT function repeatedly to activate window Frequency and set requested frequency.
5. Set output current value using cursor keys, rotary button or numerical keyboard.
6. Switch output terminals on by pushing key OPER. Output current is presented on the output terminals, OPER key is lit and indication SOURCE on the screen is green.
7. Push STBY key to switch output voltage off.

4.2.2. Non-sinusoidal Current

Calibrator can source non-sinusoidal waveforms with pre-defined shape. Frequency range for these waveforms is limited from 10 mA to 2 A and frequency range from 40 Hz to 1 kHz. Following waveforms are implemented:

- Limit. Sine sinusoidal with defined distortion 13.22 %
- Square squarewave symmetrical
- Triangle symmetrical
- Ramp Up
- Ramp Down
- Harmonic adjustable harmonic products

To select requested waveform push the soft key SHAPE, highlight requested item using softkeys ▲▼, cursor keys or rotary button and confirm with ENTER.

4.2.3. Harmonic

Calibrator has unique feature of sourcing by customer defined waveform signal. Definition on the signal is based on setting of amplitude and phase shift of harmonic products related to basic, fundamental frequency. Number of harmonic products is limited to 50 but maximum frequency of harmonic product cannot exceed 5 kHz. Amplitude of individual harmonic products cannot be higher than 10 % of amplitude of fundamental signal.

See chapter 4.1.2. and 4.1.3. for setting waveform parameters.

4.2.4. Current SETUP

Voltage function SETUP can be activated using SETUP SOURCE key. Following screen will appear:

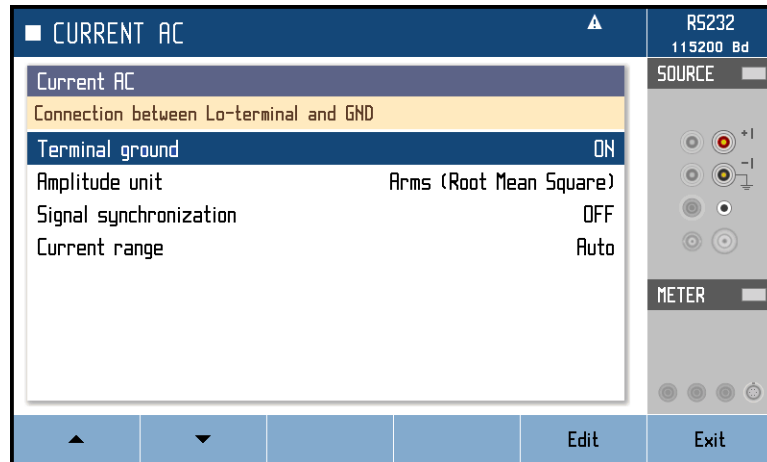


Figure 19 Current SETUP screen

SETUP offers additional setting of voltage function.

Current DC

- Terminal ground: On/Off
LO voltage output terminals is internally connected to PE wire when ON. Voltage output is floating when OFF. Symbol of ground is displayed in terminal field on screen when ON item is selected.
- Current range Auto/200 μ A/2mA/20mA/200mA/2A/20A
In AUTO setting internal ranges are automatically switched to offer the lowest uncertainty. Any internal range 200 μ A to 30 A can be fixed.

Current AC

- Terminal ground: On/Off
LO voltage output terminals is internally connected to PE wire when ON. Voltage output is floating when OFF. Symbol of ground is displayed in terminal field on screen when ON item is selected.
- Current unit: root mean square, peak, peak-peak, average
Parameter enables selection of type of unit displays on the display.
- Signal synchronization:
 - o Internal frequency and phase is given by internal oscillator
 - o Power Line synchronized to power line voltage
 - o BNC synchronized to signal input at BNC TRG connector
 - o External Master rear panel BNC Master connector synchronization
- Current range Auto/200 μ A/2mA/20mA/200mA/2A/20A
In AUTO setting internal ranges are automatically switched to offer the lowest uncertainty. Any internal range 200 μ A to 30 A can be fixed.

4.3. Resistance

Basic version of the calibrator offers continuously adjustable resistance decade LVR in range 0 to 1000 M Ω . The decade is based on resistance simulation using electronic circuits. The function is designed for calibration of standard resistance function of various multimeters which use low level signals. The mode is signed VARIABLE.

Except the resistance simulator the calibrator offers more accurate resistance in FIXED mode. In this mode only fix nominal decade valued are available however uncertainty for middle range resistance values reaches 15 ppm only.

Calibrator can be equipped with high resistance option HVR. This option offers resistance range from 10 k Ω to 100 G Ω with working voltage up to 1500 VDC. The function is aimed to calibration of insulation meters, megaohmmeters.

Push RESISTANCE function key to select resistance function.

4.3.1. LVR Low resistance decade VARIABLE mode

Low resistance decade can be used in two-wire or four-wire connection. Two-wire connection uses output terminals labelled HI and LO. Four-wire connection uses terminals HI and LO as “power” terminals and +I and -I as “sense” terminals.

Note: four-wire method of connection offers lower uncertainty of calibration especially for low resistance values due to by the principle excluded test lead resistance influence.

Low resistance mode function is based on electronic simulator of resistance. It has limited working conditions. Maximum test voltage is 20 V. See specification for test voltage and test current limitations.

If HVR High resistance decade option is installed push RESISTANCE function key repeatedly until RESITANCE LVR mode is selected. Push MODE soft key to display list of modes. Select Variable and confirm with ENTER. Connect the ohmmeter (multimeter) to the calibrator as shown below.

1. Select appropriate function and range on the ohmmeter (multimeter)
2. Set requested mode of connection either two-wire or four-wire. Use WIRE soft key to switch between both modes. Set up requested resistance value.
3. Switch output terminals on by pushing key OPER.
4. Push STBY key to switch output off.

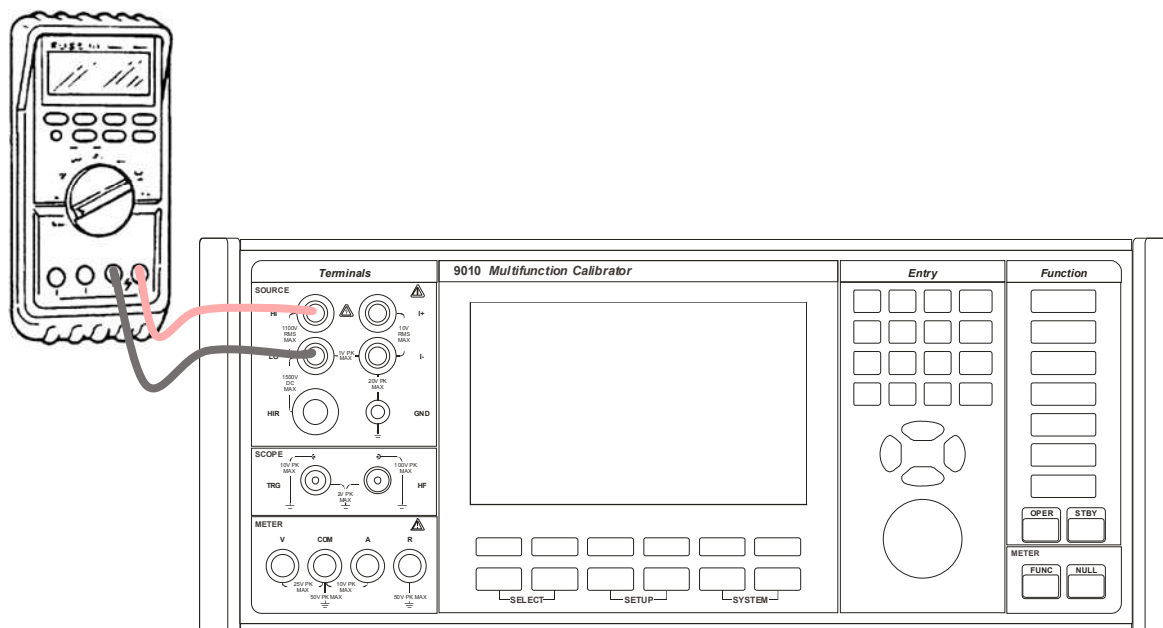


Figure 20 Two-wire resistance calibration

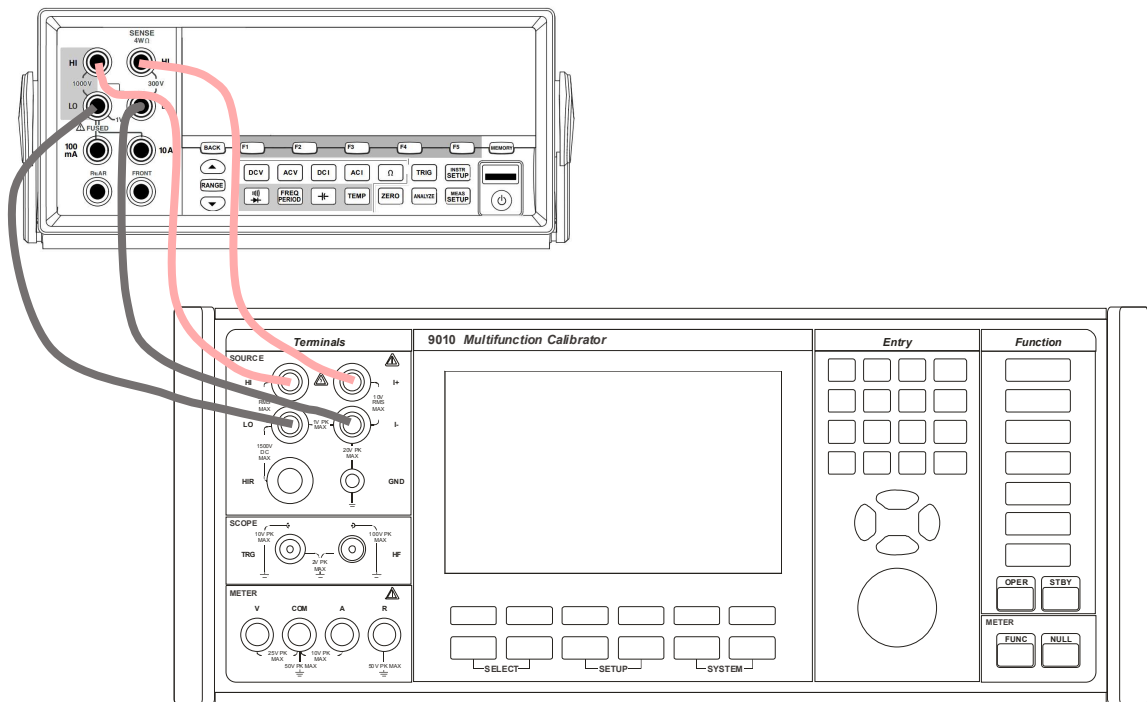


Figure 21 Four-wire resistance calibration

4.3.2. LVR Low resistance decade FIXED mode

Fixed mode offers high accuracy of sourced resistance however range of resistance is limited to fix resistance nominal values: 0.1 Ω , 1 Ω , 10 Ω , 100 Ω , 1 k Ω , 10 k Ω , 100 k Ω , 1 M Ω , 10 M Ω , 100 M Ω , 1 G Ω . Exact calibration value is always displayed on the display.

Push MODE soft key to display list of modes. Select **Fixed** item and confirm with ENTER. Push WIRE soft key to select either two-wire or four-wire connection.

Selection of individual fix value positions can be done using softkeys \blacktriangle \blacktriangledown , or cursor keys or using rotary button. Numerical keypad is not active in this mode. Calibration value is displayed on the display.

4.3.3. HVR High voltage resistance extension

High resistance decade offers fully programmable series connected resistance box in range 10 k Ω to 100 G Ω with maximum working voltage 1500 V. The decade is applicable on DC voltage. Do not use AC test signal. High resistance decade is available only in two-wire configuration.

Push MODE soft key to display list of modes. Select High resistance item and confirm with ENTER.

1. Connect the ohmmeter (multimeter) to the calibrator as shown on the figure below.
2. Select appropriate function and range on the ohmmeter (multimeter)
3. Push RESISTANCE function key on the calibrator. Push MODE soft key and select position High resistance decade.
4. Set requested resistance value.
5. Switch output terminals on by pushing key OPER.
6. Push STBY key to switch output off.

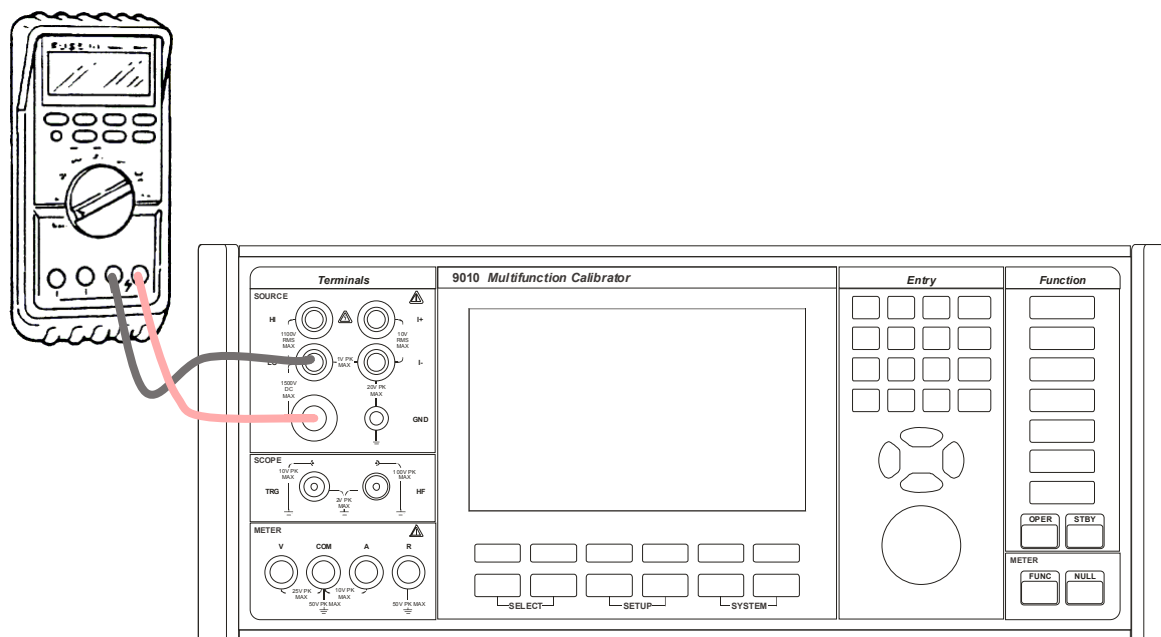


Figure 22 High resistance calibration

4.3.4. Resistance SETUP

Resistance SETUP can be activated using SETUP SOURCE key. Following parameters are available:

- Terminal ground On/Off
LO output terminals is internally connected to PE wire when parameter is set to ON.

4.4. Capacitance

Calibrator contains continuously adjustable capacitance in range from 900 pF to 100 mF with 4½ digit resolution. The decade is based on capacitance simulation using electronic circuits. The function is designed for calibration of standard resistance function of various multimeters which use low level signals. The mode is signed VARIABLE.

Except the VARIABLE mode the calibrator offers more accurate resistance in FIXED mode. In this mode only fix nominal decade values are available with basic uncertainty 0.25 %.

4.4.1. Capacitance VARIABLE mode

Low resistance mode is available in two- terminal connection only with maximum test from 2 to 5 V depending on set value. See specification for test voltage and test current limitations.

Push MODE soft key to display list of modes. Select Variable and confirm with ENTER.

1. Connect the multimeter to the calibrator as shown below.
2. Select appropriate function and range on the multimeter.
3. Push CAPACITANCE function key on the calibrator.
4. Switch output terminals on by pushing key OPER.
5. Push STBY key to switch output off.

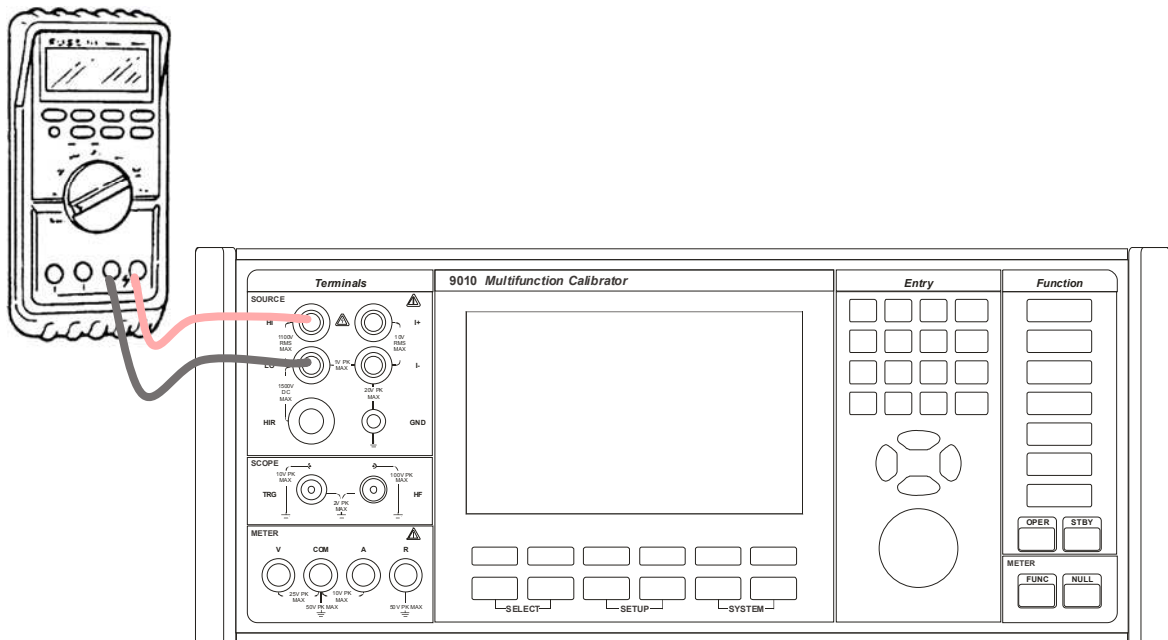


Figure 23 Capacitance calibration

4.4.2. Capacitance FIXED mode

Fixed mode offers high accuracy of sourced capacitance however range of capacitance is limited to fix resistance nominal values: 220 pF, 330 pF, 1 nF, 3.3 nF, 10 nF, 33 nF, 100 nF, 330 nF, 1 μF, 3.3 μF, 10 μF, 33 μF, 100 μF.

Push MODE soft key to display list of modes. Select Fixed item and confirm with ENTER. Selection of individual fix value positions can be done using softkeys ▲▼, or cursor keys or using rotary button. Numerical keypad is not active in this mode.

4.4.3. Capacitance SETUP

Capacitance SETUP can be activated using SETUP SOURCE key. Following parameters are available:

- Terminal ground
LO output terminals is internally connected to PE wire when parameter is set to ON.

4.5. Electric power meters, analyzers and energy meters

Calibrator can supply output voltage and current at the same time. The function is designed for calibration of electric power meters and power analyzers. Push function key POWER to select Power/energy mode.

4.5.1. DC and SIN mode

Only output voltage and current can be set in DC mode. In AC mode frequency of the output signal and phase shift between voltage and current can set as well.

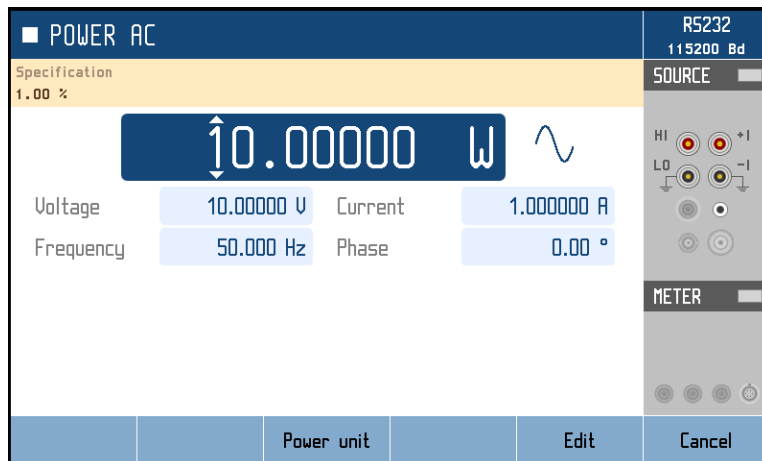


Figure 24 AC Power

1. Connect power meter to the calibrator as shown on the figure below.
2. Push POWER function key on the calibrator. Push POWER key once more to switch between DC and AC mode.
3. Set output voltage, current, frequency and phase shift using soft keys beneath the display or switch active field on the display for direct value entry using SELECT keys.
4. Push OPER key to connect output terminals. Calibrator is sourcing voltage and current.
5. Push STBY key to switch output off.

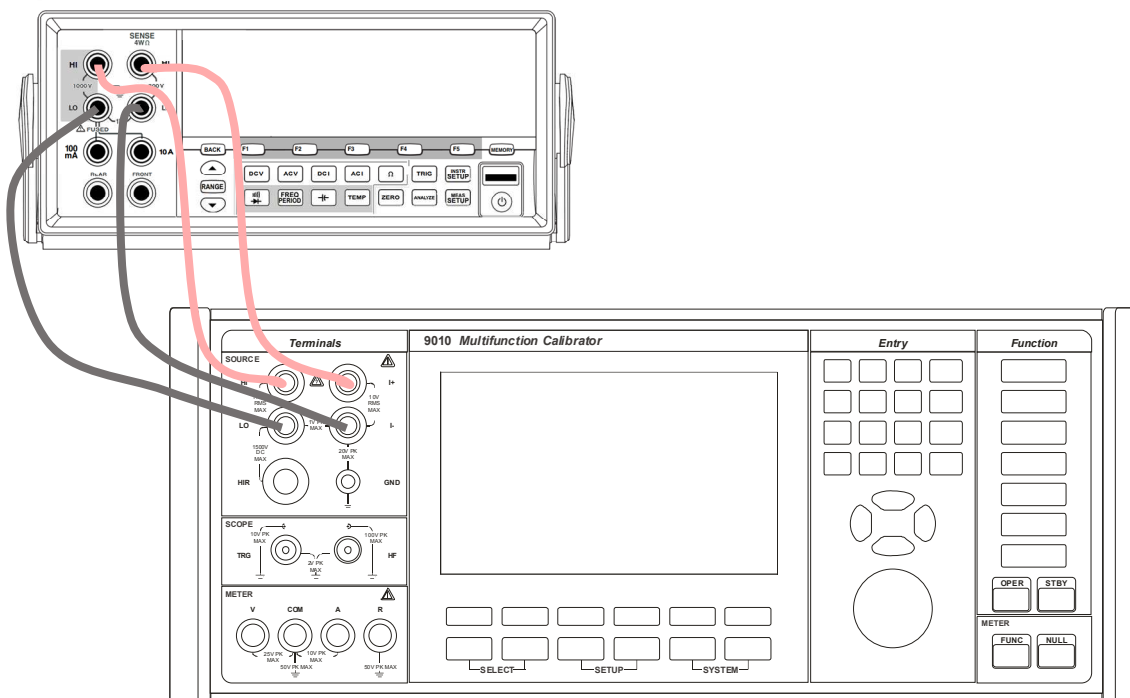


Figure 25 Power meter calibration

Calibrator features with floating current channel. Setting of grounded or floating output can be done in SETUP menu.

Sign of AC wave indicates SIN mode without distortion.

4.5.2. Harmonic mode

In Harmonic mode any distortion represented with amplitude and phase shift can be set in output signal. Harmonic content of output voltage can be set independently.

Select Power mode using POWER key. Push Harmonic soft key. Following screen will appear:



Figure 26 Harmonic mode

See chapter 4.1.3 for individual harmonic component editing, previewing, saving, and loading. Star sign in field Harmonic indicates that for the output signal has been defined harmonic distortion. Label without star sign means that the output signal is pure sin wave.

4.5.3. Energy mode

In Energy mode calibrator is sourcing output signal for defined period. Select Power mode using POWER key. Push Energy soft key. Following screen will appear:

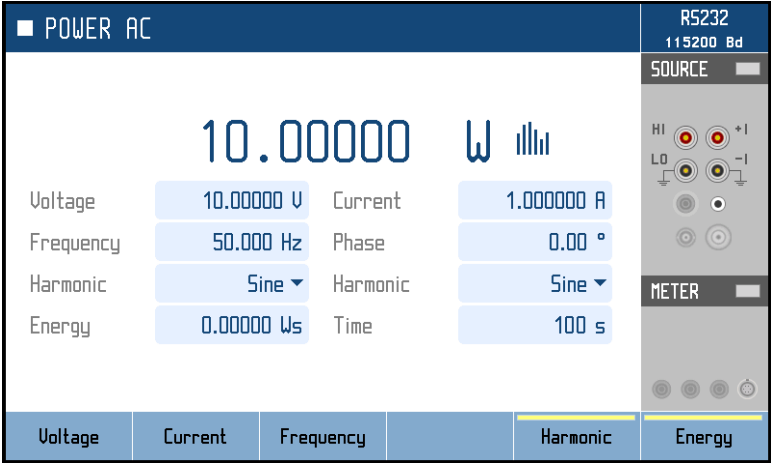


Figure 27 Energy mode

Set requested time for which output signals should be connected to the output terminals. Use SELECT soft key to move active window.

Both SIN and Harmonic mode can be applied in Energy mode.

4.5.4. Power/Energy parameters

Except main power value parameter, softkeys below the display can directly edit auxiliary parameters:



Figure 28 Power/Energy soft keys

Harmonic softkey enables setting of non-sinusoidal waveform with harmonic distortion. Move active line to position Harmonic using SELECT keys. Soft keys meaning is changed enabling setting of higher harmonic content. See chapter 4.1.3 for more details.

Energy softkey activates line for entering either requested energy portion in field ENERGY or requested time in field TIME.

Except one-touch buttons calibrator has its own parameter setting under SETUP. Push SOURCE SETUP key to call out menu with parameter setting.

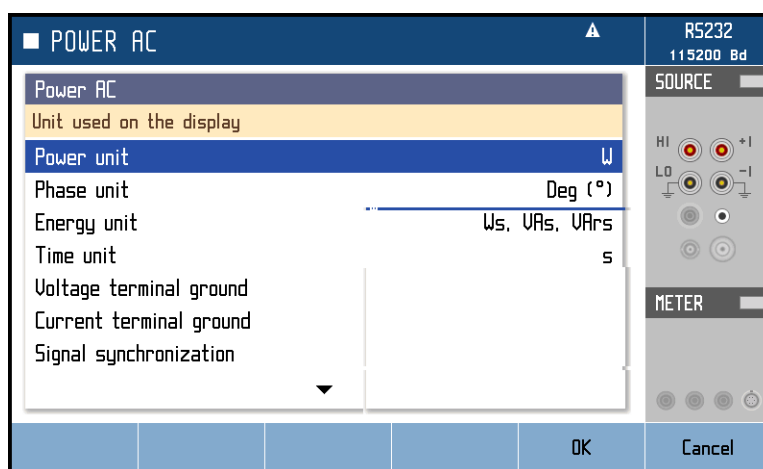


Figure 29 Energy mode

Following items can be modified:

[AC only] Power unit	W/VA/VAr	
[AC only] Phase unit	Degrees (°) or Cos (Lead, Lag)	
[AC only] Energy unit	Ws/VAs/VAr.s/Wh/VAh/VAr.h	
Time unit	s (second) / hms (format hh:mm:ss)	
Voltage terminal ground	On/Off	Voltage LO output terminal grounded/floating
Current terminal ground	On/Off	Current LO output terminal grounded/floating
[AC only] Signal synchronization	Internal	frequency and phase is given by internal oscillator
	Power Line	synchronized to power line voltage
	BNC	synchronized to signal input at BNC TRIG connector
	External Master	Rear panel external input
[AC only] Phase shift	x.xxx Degrees (°) or Cos (Lead, Lag).	Phase shift between voltage and current
Energy mode	Enabled/Disabled	
[AC only] Harmonic mode	Enabled/Disabled	
Voltage range	Auto/2V/20V/100V/280V/1000V	
Current range	Auto/2mA/20mA/200mA/2A/20A. Coils extend ranges by their multipliers when used.	
Voltage from current range	Disabled/Enabled	enables generating voltage from current output terminals +I/-I instead of current
Current mode	Normal: +I/-I terminals are used directly for current output	
	Voltage from current: +I/-I terminals are used as second voltage output	
	Coil: +I/-I terminals are used for external current coil connection	

4.5.5. Voltage from current function

The function enables to source output voltage from current terminals. Two synchronous voltage outputs are practically available in this mode. Simple resistance converter is used for transformation inside the calibrator. Range of output voltage is 5 mV to 5 V, AC or DC. Using setting of equivalent coefficient appropriate range of simulated current can be set.

Note: The function is useful for those wattmeter's calibration which sensing current terminals use millivolt input.

4.6. SCO scope extension

Optionally, calibrator can be equipped with scope option. The option is primarily designed for calibration of oscilloscopes. Scope option contains following modes:

Mode	Description	Application	Range	Terminal
Voltage - Low	DC and Low frequency voltage up to 100 kHz and 10.5 V _{pk}	LF calibration of horizontal sensitivity	0 – 10.5 V _{pk}	N connector
Voltage - High	DC and Low frequency voltage up to 1 kHz and 200 V _{pk}	LF calibration of horizontal sensitivity	0 – 200 V _{pk}	HI – LO terminals
Sine	High frequency sinewave with adjustable amplitude up to 1.5 V _{pk}	Frequency fleetness of horizontal channel	15 Hz – 400 MHz	N connector
Pulse	Pulse width modulation with adjustable amplitude and ratio	Time base calibration	1 – 50 %	N connector
Time marker	Time markers with adjustable ratio and amplitude	Time base calibration	0.1 Hz – 400 MHz	N connector

Table 2 Scope option modes

Select SCOPE function using SCOPE key, following screen will appear:

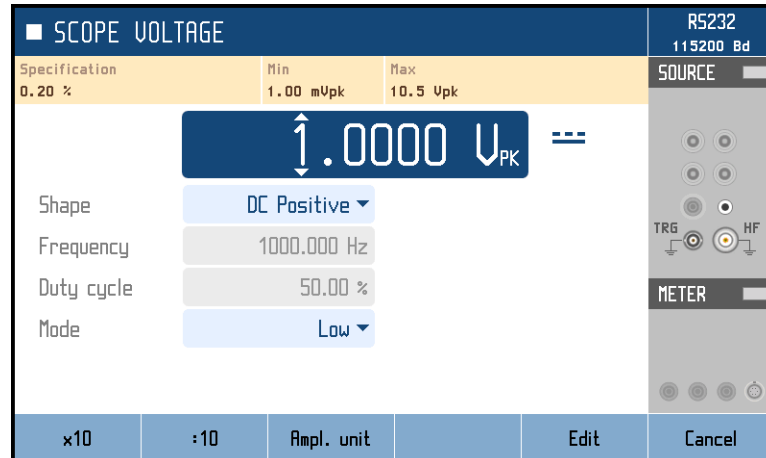


Figure 30 Scope option

Push the SCOPE key repeatedly to swap between Voltage – SINE – PWM – Time marker mode.

4.6.1. Low frequency and DC calibration

DC and squarewave calibrated signals are available in this mode. Requested mode Voltage can be selected after pushing soft key Shape. Following list of waveforms is displayed:

- DC Positive DC positive voltage with adjustable level
- DC Negative DC negative voltage with adjustable level
- Positive square Positive square wave signal with adjustable duty cycle ratio and frequency
- Negative square Negative square wave signal with adjustable duty cycle ratio and frequency
- Symmetric square Symmetric square wave signal with adjustable duty cycle ratio and frequency

Low mode output

Voltage mode has two submodes Low and High. In Low mode output signal is connected to the front panel coaxial connector. This mode offers frequency range to 100 kHz for square wave signals.

High mode output

In High mode output signal is connected to HI – LO output terminals. It is identical to ACV function.

Displayed units of amplitude can be set by pressing \rightarrow SELECT key to enter main value edit mode, then pressing Unit softkey and choosing one of the following units: V_{rms} (root mean square), V_{pk} (peak), V_{pp} (peak – peak), V_{avg} (average), dBu (dB microvolt), dBV (dB volt), dBm (dB miliwatt).

To calibrate an oscilloscope:

1. Connect the oscilloscope to N connector (Low mode) or to HI – LO terminals (Low) mode.
2. Set appropriate mode Low/High using Mode softkey.
3. Select requested waveform using soft key Shape and confirm with Enter.
4. Set requested frequency, amplitude, duty cycle ratio.
5. Push the OPER key to connect signal to the output terminals.

4.6.2. Sine mode

Sine mode offers calibrated sinewave voltage starting from 20 Hz at low frequency end up to 400 MHz at high frequency end. Waveform has low distortion and stabilized amplitude. Output impedance is 50 Ω . Select the Sine mode by pushing the SCOPE key until screen with Sine mode is displayed. Following values are available for setting:

- Frequency in Hz
- Amplitude in preselected unit V_{rms} , V_{pk} , V_{pp} , V_{avg} , dB μ , dBV, dBm

Push the OPER key to connect signal to the output terminals.

Output resistance can be set to Low Z or 50 Ω in frequency range 20 Hz to 100 kHz. Low Z range means output impedance is lower than 0.5 Ω . Fix output resistance 50 Ω is only available for frequency above 100 kHz.

4.6.3. Pulse mode

In Pulse mode repeated pulses with defined frequency and duty cycle ratio. Pulse width is displayed on the screen as well. Output impedance is 50 Ω . Select the Pulse mode by pushing the SCOPE key until screen with Pulse mode is displayed. Following values are available for setting:

- Frequency in Hz
- Amplitude in preselected unit V_{rms} , V_{pk} , V_{pp} , V_{avg} , dB μ , dBV, dBm
- Duty cycle ratio

Push the OPER key to connect signal to the output terminals. Indicated pulse width is calculated by formula $\Delta = 1/f * R/100$ [s], where f is frequency of output signal and R is duty cycle ratio in %.

4.6.4. Time marker mode

Time marker mode sources time pulses with defined width and adjustable period (frequency). Amplitude of the time markers can be adjusted in several predefined levels. Output impedance is 50Ω. Select the Time Marker mode by pushing the SCOPE key until screen with Time Marker mode is displayed. Following values are available for setting:

- Period in μ s, ms, s
- Marker width in terms of duty cycle ratio in predefined levels 1, 10, 20, 30, 40, 50 % up to 4 MHz, in predefined levels 10, 20, 30, 40, 50 % up in range 4 MHz to 10 MHz and 2 ns width spikes above 10 MHz
- Amplitude in preselected unit V_{rms} , V_{pk} , V_{pp} , V_{avg} , dB μ , dBV, dBm in predefined levels 50 mV, 100 mV, 500 mV, 1V peak

Push the OPER key to connect signal to the output terminals.

4.6.5. Scope SETUP

Scope SETUP can be activated using SETUP SOURCE key. Following screen will appear:

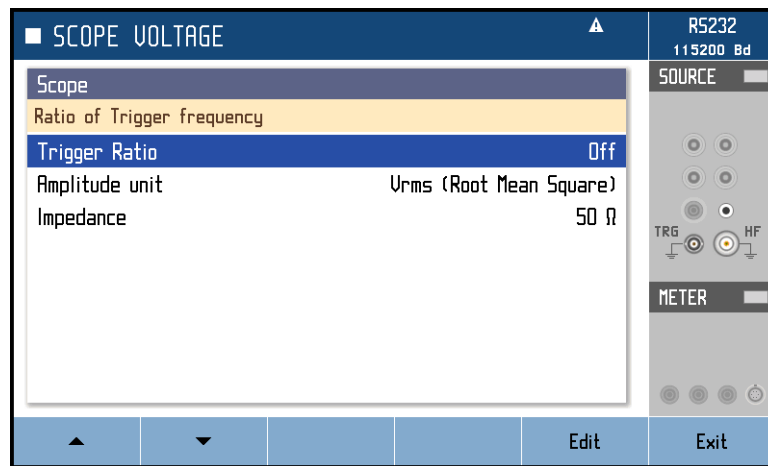


Figure 31 SCO option Device/Setup menu

4.6.6. Triggering

Output voltage of the SCOPE option can be triggered by external signal connected to coaxial BNC connector on the front panel. Square wave signal with amplitude over 1 V_{pk} is expected. Input resistance of the triggering input is 50 Ω. Only one parameter selection is available for triggering signal, Trigger Ratio.

To change setting push the SETUP key in SCOPE function, chose item Trigger Ratio and select one of values Off, /1, /10, /100 . The number indicates nominal ratio of the frequency between triggering and output signal.

Output impedance

Scope option has two impedance configurations of HF coaxial output connector, 50 Ω and Low Z output impedance. Requested setting can be selected in Scope SETUP, item Impedance. In Low Z mode output impedance is close to zero Ω, typ. < 1Ω, in 50 Ω mode is output impedance set to 50 Ω ± 2 %. Setting of output impedance is indicated in the field SOURCE on the display using labels „LOW Z“ and „50 Ω“.

Amplitude unit

Last item in the SETUP menu is selection of displayed units. Change of unit can be performed also in individual subfunctions using soft key Ampl. Unit.

4.7. Temperature sensor simulation

Calibrator can simulate various, most frequently used temperature sensors, both resistance RTD type and thermocouple TC type. The function is accessible after function selection key OPTION pushing followed by selection of type of sensor.

4.7.1. RTD temperature sensor simulation

In TEMPERATURE RTD function calibrator simulates resistance temperature sensor by connecting such resistance to the output terminals which corresponds set temperature. Following screen appears after the function selection:

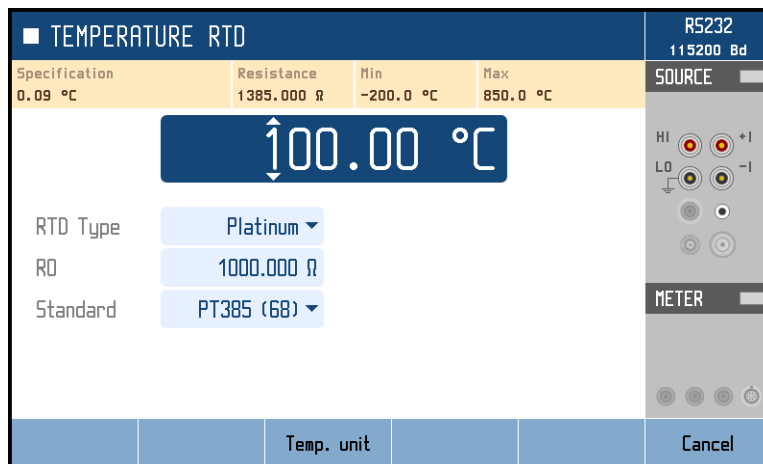


Figure 32 RTD temperature sensor simulation

To simulate an RTD temperature sensor:

1. Connect thermometer input to HI – LO, +I – -I terminals.
2. Select RTD type sensor using RTD Type soft button, either Platinum or Nickel.
3. Set nominal resistance of the sensor at 0. °C R0. For Pt 100 sensor the value is 100.000 Ω. Use R0 soft button.
4. Select a predefined temperature scale or create a custom scale and select „PT user“ to access it.
5. Enter requested temperature value into main field on the display to simulate temperature sensor.
6. Push the OPER key. Calculated resistance corresponding to the set temperature is connected to the output terminals. Real resistance value is displayed in yellow information line in upper part of the display. If the line is hidden, push any key for value setting cursor key, rotary button or SELECT arrow key.

Resistance is connected to HI – LO and +I – -I terminals in 4W configuration. HI – LO terminals are “power” terminals, +I – -I terminals are “sense” terminals.

RTD Simulation SETUP

TEMPERATURE RTD function has related SETUP function. The SETUP can be opened by pushing the key SOURCE SETUP. It contains following items:

- Temperature unit selection, °C, °F or K
 - Terminal ground, enables internally LO output terminal grounding
- Coefficients of „PT User“ scale. RTD calculation formula is

$$R_{sim} = R_0 * (1 + T*(A + T*(B + T*C(T-100.0))))$$

, where T is temperature in °C and R0 is nominal resistance of temperature sensor at 0 °C.

4.7.2. Thermocouple temperature sensor simulation

In TEMPERATURE TC function calibrator simulates thermocouple temperature sensor by sourcing such DC voltage to the output terminals which corresponds set temperature and selected type of sensor. Following screen appears after the function selection:

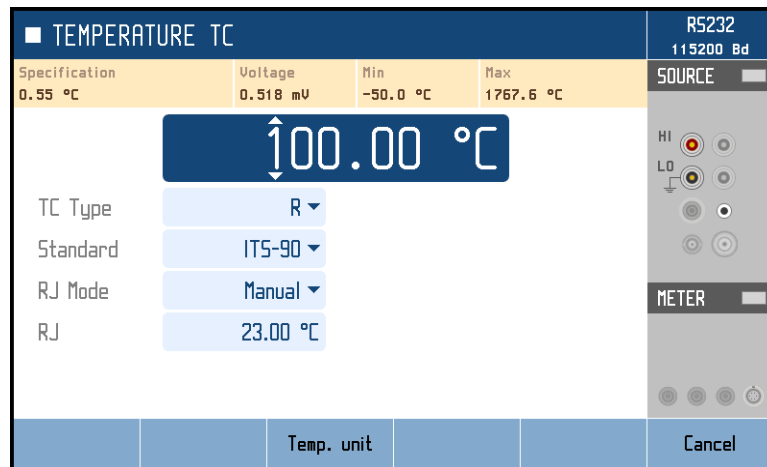


Figure 33 TC temperature sensor simulation

To simulate a TC temperature sensor:

1. Connect thermometer input to HI – LO output terminals.
2. Select TC Type sensor, one of following R, S, B, J, T, E, K, N, M, C, D, G2
3. Select requested temperature standard PTS-68 or ITS-90
4. Select Manual RJ mode and enter cold junction temperature into RJ field. With MER option and Adapter 91 connected as in picture below you can also use Auto compensation mode:

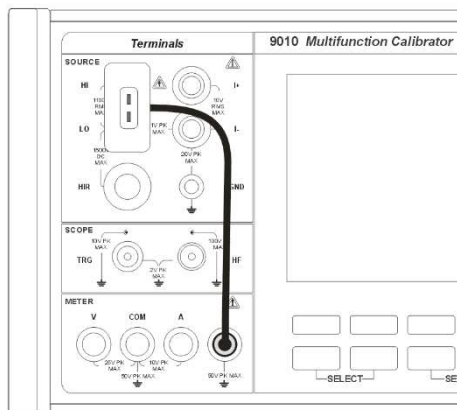


Figure 34 TC External cold junction compensation using Adapter 91

5. Enter requested temperature value into main field on the display to simulate temperature sensor.
6. Push the OPER key to activate output. Real DC voltage level is displayed in yellow information line in upper part of the display. If the line is hidden, push any key for value setting cursor key, rotary button or SELECT arrow key.

TC temperature sensor simulation SETUP

TEMPERATURE TC function has related SETUP function. The SETUP can be opened by pushing the key SOURCE SETUP. It contains following items:

- Temperature unit selection, °C, °F or K
- Terminal ground, enables internally LO output terminal grounding
- Output mode either passive (more accurate) or active (higher current available)

4.8. MER multimeter extension

4.8.1. Input terminals

The calibrator is equipped with built-in process multimeter. The multimeter offers directly basic measurement of output signal of various transmitters, evaluation units, energy counters, etc. without need of any other measuring instrument. Except it, the multimeter serves as thermometer for External reference junction adapter used for automatic compensation of cold junction temperature when thermocouple sensor is simulated.

Multimeter field appears on the screen after pushing the key METER FUNC. Information line with multimeter readings and basic setting is displayed then in bottom part of the screen.

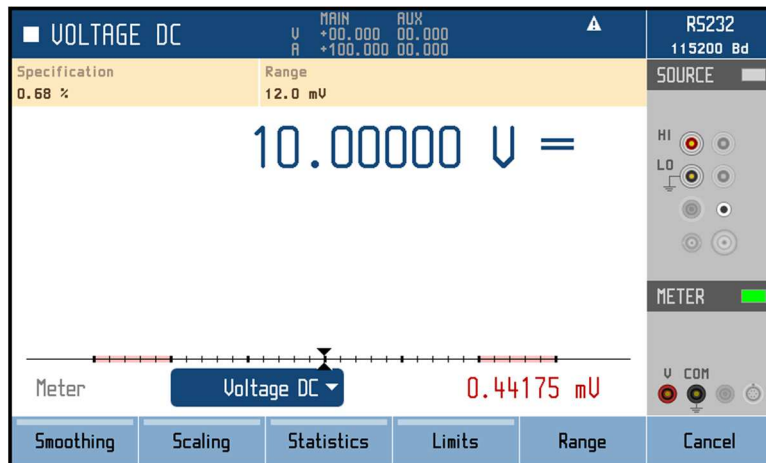


Figure 35 Process multimeter

To measure external signal:

1. Connect source of signal to the input terminals:
 - Use A and COM terminals for current measurement.
 - Use 9000-60 adapter connected to R terminal to measure resistance and RTD temperature sensors.
 - Use V and COM terminals for all other meter functions. When measuring thermocouples with auto cold junction compensation, connect Adapter 91 as follows:

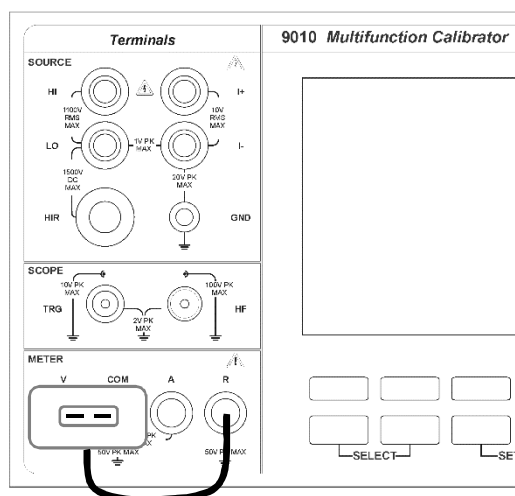


Figure 36 Thermocouple output through 91 Adapter

2. Select requested function. Use SELECT arrows key and rotary button or cursor keys.
3. Multimeter starts measuring of the input signal.

Null button

Reading on the display can be nulled at any time with NULL button. When Null function is active, LED key NULL lit and symbol NULL is displayed in METER information field on the screen. To cancel nulling function push NULL key again.

4.8.2. Softkey functions

Multimeter function has direct access to several subfunctions. Push SELECT key until active window Meter is selected. Meaning of soft keys beneath the display is changed. Soft keys enables fast access to following functions:

Smoothing	Scaling	Statistics	Limits	Range	Cancel
-----------	---------	------------	--------	-------	--------

Figure 37 Multimeter softkeys

- Smoothing Smoothing filter activation
- Scaling Allow to scale measurements relative to a reference value
- Statistics Statistical data can be displayed
- Limits Limits of band setting
- Range Auto or fix range selection

Smoothing

The function enables activation of smoothing filter and setting integration time in terms of number of samples which are averaged. Set item Smoothing to ON to activate the filter.

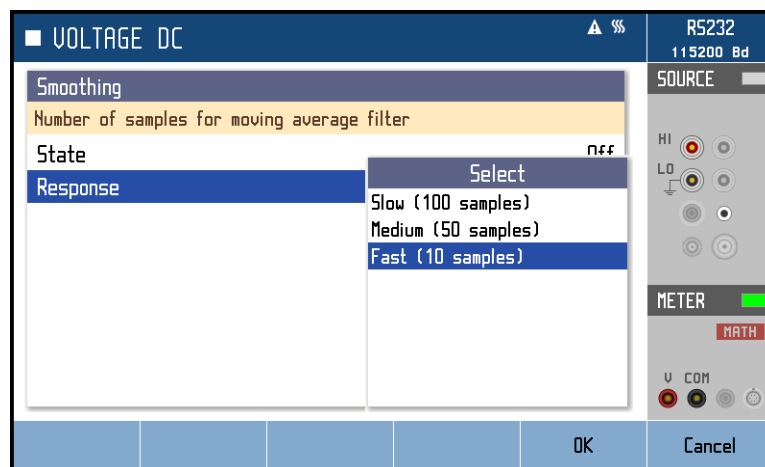


Figure 38 Meter smoothing filter

Scaling

The Scaling function allows recalculation of multimeter readings. Press Scaling softkey to set scaling parameters:

- Scaling. Use this item to turn scaling ON. Scaling is automatically turned off after each meter function change (for example changing from DCV to ACV).
- Function. „%“ shows relative value and „Scale“ shows absolute value, based on formulas

$$\text{Rel. value [\%]} = (\text{reading} - \text{Reference}) / \text{Reference} \cdot 100 \quad \text{and} \quad \text{Abs. value} = \text{Gain} \cdot \text{reading} + \text{Offset}$$

- Gain, Offset and % Reference. Scaling formula parameters.
- Custom unit and Custom unit label. Custom unit with length up to 4 alphanumerical characters can be defined. Use navigation buttons or rotary knob to enter requested letters, switch between uppercase and lowercase using A ↔ a softkey and enable this feature by turning Custom unit ON.

Statistics

Reading of the multimeter are statistically evaluated when STATISTICS function is switch on. Use Statistics soft key to display statistic parameters. Symbol MATH is displayed in METER information field. Following data are displayed:

- Min Minimum reading
- Max Maximum reading
- Span Max-Min difference
- Average Average value from all collected readings
- St. deviation Standard deviation of the collected readings
- Count Number of readings

STATISTICS function can be disabled by pushing soft button Statistics or readings can be reset by pushing soft key Clear.

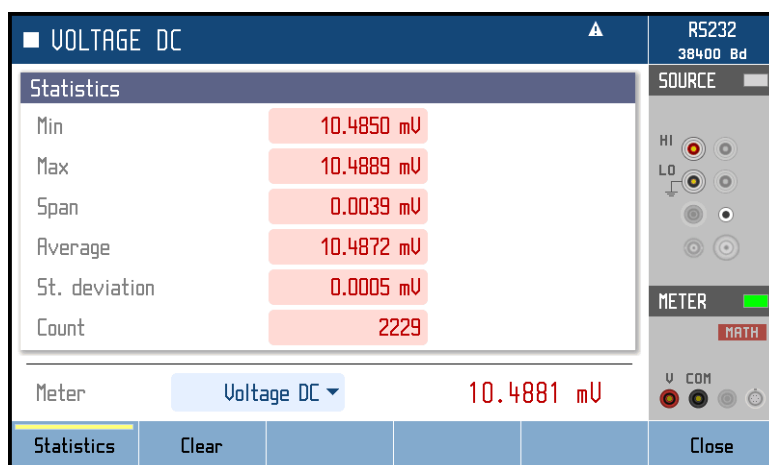


Figure 39 Meter statistics function

Limits

LIMITS function displays indication whether reading is inside or outside predefined limits. Lower and upper limit must be entered before switching the function ON. Default value is 0.000000 for both values. Indication of reading versus limits is displayed in METER field using LIMT label with arrows showing if the reading is below, inside or up. The LIMITS function is applicable in all multimeter functions.

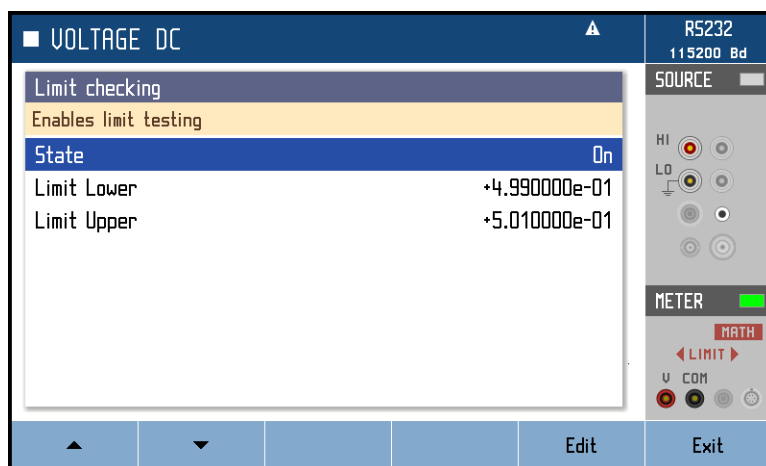


Figure 40 Meter limits function

4.8.3. Meter SETUP

The multimeter has related SETUP menu offering selection of parameters shown in table below. Push METER SETUP key to display SETUP screen.

Item	Subitem (if any)	Values	Meaning
Function	Voltage DC, Current DC, Lo Current DC, Frequency, Resistance, RTD, TC		Selected meter function
Ranges	Voltage DC	Auto/12mV/120mV/1.2V/12V/120V/1000V	Fixed range or autorange selection
	Voltage AC	Auto/12mV/120mV/1.2V/12V/120V/1000V	
	Current DC	Auto/2.4mA/24mA	
	Current AC	Auto/2.4mA/24mA	
	Lo Current DC	Auto/1nA/10nA/100nA/1μA/10μA/100μA/1mA	
	Resistance	Auto/2kΩ/20kΩ	
	Frequency	Auto/10kHz/10MHz	
	RTD	Auto/2kΩ/20kΩ	
	TC	Auto/12mV/120mV	
Terminal ground	On/Off		COM terminal grounding
Input impedance	10MΩ/High Z (over 1GΩ)		Selection of voltmeter input resistance.
Frequency input	AC passive / DC passive / DC Active (pull up)		Way of sensing input signal
AC filter	100Hz/100kHz		Input bandwidth
Temperature unit	°C/°F/K		Temperature unit
TC	Type	R/S/B/J/T/E/K/N/M/C/D/G2	TC type
	Standard	PTS-68/ITS-90	Temperature scale selection
	RJ mode	Manual/External	Cold junction compensation
	RJ Value	xx.xx °C	Cold junction temperature
RTD	Type	Platinum/Nickel	RTD type
	Standard	PTS-68/ITS-90	Temperature scale selection
	R0	xxx.xxx Ω	Sensor resistance at 0°C
	RTD Coefficient A	x.xxxxxx	Approximation coefficients
	RTD Coefficient B	x.xxxxxx	
	RTD Coefficient C	x.xxxxxx	
Integration time	50/60/100/200/400/800 ms		Reading refresh rate
Auto offset	On/Off		Automatic offset correction
Mathematics	Smoothing		See details in chapter 4.8.2
	Scaling		
	Statistics		
	Limit checking		

Table 3 Multimeter SETUP

Direct access to the mathematic parameters is also using soft keys beneath display: Smoothing, Scaling, Statistics and Limits. The mathematic functions which have been switch on have indication with yellow bar in soft key description in the bottom line. **MATH** label is simultaneously displayed in METER field showing that mathematic function has been applied.

5. Performance verification

Specifications of this calibrator are defined for 1 year period so it should be periodically tested (and adjusted if necessary) within the same period of time. If you don't have the necessary equipment or can't do the calibration on your own, please ask local Meatest representative to help you calibrate this device.

5.1. Required equipment

Following instruments are required for performance verification test:

- 8½ digit multimeter type or Fluke 8508A/8588A, or other type with accuracy 10 ppm or better on DC voltage, 100 ppm on AC voltage
- Single Channel LF Power Meter / Power Analyzer 1000V/30A like Zimmer LMG6100, LMG500 or similar with accuracy 0.025 % or better.
- Counter Keysight 53181A or similar with accuracy 1 ppm or better.
- LCR meter type Keysight U4980A or similar with accuracy 0.1 % at 1 kHz or better
- Megaohmmeter Quadtech 1865 or similar with resistance range up to 100 GΩ or more (when HVR option is installed)
- RF voltmeter/wattmeter type Thermal Power Sensor Rohde&Schwarz NRP-Z51 or equivalent with character impedance 50 Ω (when SCO option is installed)

5.2. Verification procedure

1. Place the calibrator to the standard condition and let it switched on for at least one hour in a laboratory in reference conditions 22 °C to 24 °C.
2. Set Terminal ground item in 9010's SOURCE SETUP menu to ON in order to suppress mains noise during measurement.
3. Connect output/input terminals of the calibrator to the input voltage terminals of the standard device. Set parameters which enables the most accurate measurement in standard device.
4. Use table in chapter 5.3 to verify all recommended test points. Measured deviation should not exceed the limits in tables.
 - a. DC voltage test
 - b. AC Low frequency SINE voltage test
 - c. DC current test
 - d. AC current SINE test
 - e. AC power and phase test
 - f. Variable resistance LVR test
 - g. Fixed resistance LVR test
 - h. Variable capacitance test
 - i. Fixed capacitance test
 - j. High Voltage Resistance Variable (HVR option only)
 - k. High Voltage Resistance Fixed (HVR option only)
 - l. Frequency test (1 MHz)
 - m. HF voltage test (SCO option only)
 - n. Non-sinusoidal voltage test
 - o. Meter test covering DC voltage, DC current, frequency and resistance tests

5.3. Test points

Function	Range	Nominal	Min value	Max value	Unit	Standard unit	Test parameters
DC Voltage	20	10	9.977	10.022	mV	8½ digit DMM	DC
		19	18.975	19.024	mV		
	20	10	9.969	10.03	mV		DC, passive output
		19	18.968	19.031	mV		
	200	100	99.975	100.024	mV		DC
		190	189.971	190.028	mV		
	200	100	99.992	100.007	mV		DC, passive output
		190	189.988	190.011	mV		
	2	1	0.999955	1.000045	V		DC
		1.9	1.899923	1.900076	V		
	20	10	9.9996	10.0004	V		
		19	18.99928	19.00071	V		
	100	90	89.9957	90.0043	V		
	280	200	199.9905	200.0095	V		
	1000	900	899.948	900.052	V		
AC Voltage SINE	20	10	9.95	10.05	mV	8½ digit DMM	1 kHz
		19	18.932	19.068	mV		
	200	100	99.82	100.18	mV		
		190	189.73	190.27	mV		
	2	1	0.99963	1.00037	V		
		1.9	1.8994	1.90059	V		
	20	10	9.9963	10.0037	V		
		19	18.994	19.0059	V		
	100	90	89.972	90.027	V		
	280	200	199.928	200.072	V		
DC Current	1000	750	749.63	750.37	V		
	200	100	99.93	100.07	μA	8½ digit DMM	DC
	2	1	0.99962	1.00038	mA		
		1.9	1.89936	1.90063	mA		
	20	10	9.9979	10.0021	mA		
		19	18.9965	19.0034	mA		
	200	100	99.979	100.021	mA		
		190	189.965	190.034	mA		
	2	1	0.99967	1.00033	A		
		1.9	1.89949	1.90051	A		
	20	10	9.9955	10.0045	A		
		19	18.9932	19.0067	A		

Function	Range	Nominal	Min value	Max value	Unit	Standard unit	Test parameters
AC Current SINE	200	100	99.72	100.28	μA	8½ digit DMM	1 kHz
	2	1	0.99885	1.00115	mA		
		1.9	1.89808	1.90191	mA		
	20	10	7.995	12.005	mA		
		19	16.9905	21.0095	mA		
	200	100	99.93	100.07	mA		
		190	189.885	190.115	mA		
	2	1	0.9991	1.0009	A		
		1.9	1.89847	1.90153	A		
	20	10	9.984	10.016	A		
		19	18.975	19.025	A		120 Hz
AC Power & Phase	200	200	199.8	200.19	VA	Power meter	100V/2A/50Hz/PF=1
	4000	4000	3994.4	4005.5	VA		200V/20A/50Hz/PF=1
	200	200	199.51	200.48	VA		100V/2A/50Hz/PF=0.5
	4000	4000	3989.4	4010.6	VA		200V/20A/50Hz/PF=0.5
Variable Resistance LVR	0	0	-0.001	0.001	Ω	8½ digit DMM	4W
	10	10	9.996	10.004	Ω		
	33	30	29.9915	30.0085	Ω		
	100	100	99.984	100.016	Ω		
	330	300	299.967	300.033	Ω		
	1	1	0.999897	1.000103	kΩ		
	3.3	3	2.99967	3.00033	kΩ		
	10	10	9.99897	10.00103	kΩ		
	33	30	29.9967	30.0033	kΩ		
	100	100	99.9897	100.0103	kΩ		
	330	300	299.967	300.033	kΩ		
	1	1	0.99984	1.00015	MΩ		2W
	3.3	3	2.99952	3.00048	MΩ		
	10	10	9.9979	10.002	MΩ		
	33	30	29.9697	30.0303	MΩ		
	100	100	99.7997	100.2003	MΩ		
	330	300	299.099	300.9	MΩ		
	1000	1000	992.999	1007.001	MΩ		

Function	Range	Nominal	Min value	Max value	Unit	Standard unit	Test parameters
Fixed Resistance LVR (min and max relative to calibration values)	0	0	0.0001	0.0001	Ω	8½ digit DMM	4W
	1	1	-0.0001	+0.0001	Ω		
	10	10	-0.0002	+0.0002	Ω		
	100	100	-0.0015	+0.0015	Ω		
	1	1	-0.000015	+0.000015	k Ω		
	10	10	-0.00015	+0.00015	k Ω		2W, low voltage mode
	100	100	-0.0015	+0.0015	k Ω		
	1	1	-0.00003	+0.00003	M Ω		
	10	10	-0.005	+0.005	M Ω		
	100	100	-0.1	+0.1	M Ω		
	1000	1000	-2.5	+2.5	M Ω		
Variable Capacitance	1	1	0.98	1.02	nF	LCR meter	1 kHz
	3.3	3	2.97	3.03	nF		
	10	10	9.95	10.05	nF		
	33	30	29.85	30.15	nF		
	100	100	99.5	100.5	nF		
	330	300	297	303	nF		300 Hz
	1	1	0.99	1.01	μ F		
	3.3	3	2.955	3.045	μ F		
	10	10	9.85	10.15	μ F		120 Hz
	33	30	29.4	30.6	μ F		
	100	100	97.5	102.5	μ F	8½ digit DMM	Ramp method
	330	300	291	309	μ F		
	1000	1000	970	1030	μ F		
	10	10	9.5	10.5	mF		
	120	100	95	105	mF		
Fixed Capacitance (min and max relative to calibration values)	1	1	-0.025nF	+0.025nF	nF	LCR meter	1 kHz
	10	10	-0.035nF	+0.035nF	nF		
	100	100	-0.25nF	+0.25nF	nF		300 Hz
	1	1	-0.0025 μ F	+0.0025 μ F	μ F		
	10	10	-0.035 μ F	+0.035 μ F	μ F		120 Hz
	100	100	-0.8 μ F	+0.8 μ F	μ F		

Table 4 List of main test points

5.3.1. HVR, SCO and MER test points

HVR functions	Range	Nominal	Min value	Max value	Unit	Standard unit	Test parameters
High Voltage Resistance	100	100	99.8	100.2	kΩ	8½ digit DMM	2W, DC
	200	190	189.62	190.38	kΩ		
	1000	900	898.20	901.80	kΩ		
	2	1.9	1.8943	1.9057	MΩ		
	10	9	8.9730	9.0270	MΩ		
	20	19	18.905	19.095	MΩ		
	100	90	89.55	90.45	MΩ		
	200	190	189.05	190.95	MΩ		
	1000	900	895.50	904.50	MΩ		
	2	1.9	1.881	1.919	GΩ	Megaohmmeter	2W, 500 V _{dc}
	10	9	8.91	9.09	GΩ		
	100	100	cal. val. -3	cal. val. +3	GΩ		
SCO functions	Range	Nominal	Min value	Max value	Unit	Standard unit	Test parameters
Frequency	1	1	0.999975	1.000025	MHz	Counter	SIN mode
HF Voltage	10	10	9.75	10.25	mV	RF voltmeter	10 MHz
	100	100	97.5	102.5	mV		
	1	0.8	0.78	0.82	V		100 MHz
	100	100	96.7	103.3	mV		
	1	0.8	0.773	0.826	V		400 MHz
	100	100	96.3	103.7	mV		
Non-sinusoidal voltage	100	100	99.65	100.35	mV	8½ digit DMM	DC
	1	1	0.99695	1.00305	V		
	10	10	9.96995	10.03005	V		
MER functions	Range	Nominal	Min value	Max value	Unit	Setup and connection scheme	
Voltage	12	10	9.9969	10.0031	mV	Set both source and meter functions to Voltage DC. Connect Hi to V and Lo to COM terminals on 9010. Use standard 8½ digit DMM to measure voltage at Hi/Lo terminals.	
	120	100	99.990	100.010	mV		
	1.2	1	0.9999	1.0001	V		
	12	10	9.999	10.001	V		
Lo Current	100	100	99.96	100.04	μA	Set both source and meter functions to Current DC. Connect I+ to A terminals on 9010. Use standard 8½ digit DMM to measure current between COM/I- terminals.	
	1	1	0.9997	1.0003	mA		
Current	2.4	2	1.9988	2.0012	mA		
	24	20	19.9962	20.0038	mA		
Frequency	100	1	0.99995	1.00005	kHz	Set source to Voltage AC, 1 V, 1 kHz. Connect Hi to V and Lo to COM terminals on 9010. Use standard counter to measure frequency at Hi/Lo terminals.	
Resistance	2	1	9.99979	1.00021	kΩ	Set both source and meter functions to resistance. Use 9000-60 adapter to connect meter to source terminals (Hu to Hi, Lu to Lo, Hi to I+ and Li to I-). Use standard 8½ digit DMM to measure resistance at source terminals.	
	20	10	19.996	20.004	kΩ		

Table 5 List of options' test points

6. Adjustment

Adjustment is done through MENU > Calibration > Data. This menu item is password protected, default factory set calibration code is “9010”.

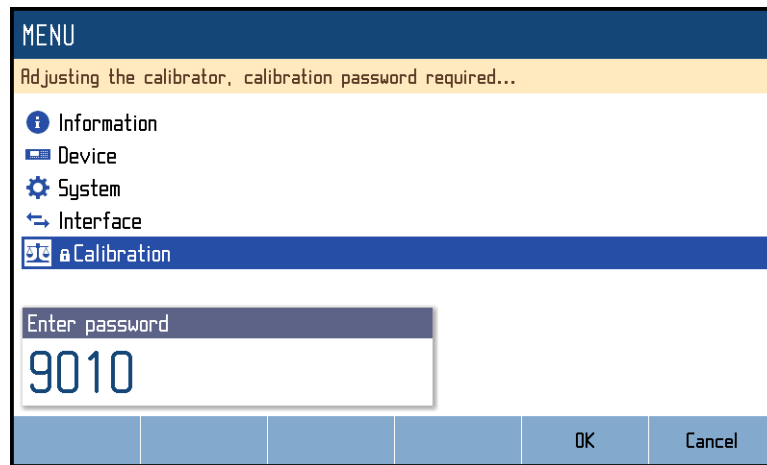


Figure 41 Password entry

6.1. Calibration menu structure

Calibration data are sorted in a tree structure with following hierarchy:

1. Function groups (source and measurement)
2. Functions (f.e. Voltage DC)
3. Ranges (f.e. 10 V)
4. Calibration points (f.e. zero offset)

As with any other menu you can navigate through the tree structure using cursor buttons, rotary knob or softkeys. **⌘** symbol indicates calibration tree branches with out-of-date or otherwise invalid calibration data:

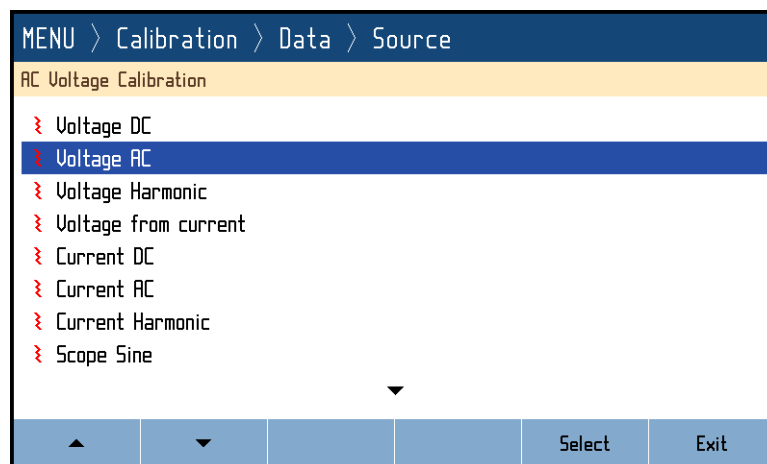


Figure 42 Calibration menu with out-of-date calibration data

Once range level of the tree structure is reached, calibration points are displayed in following format:

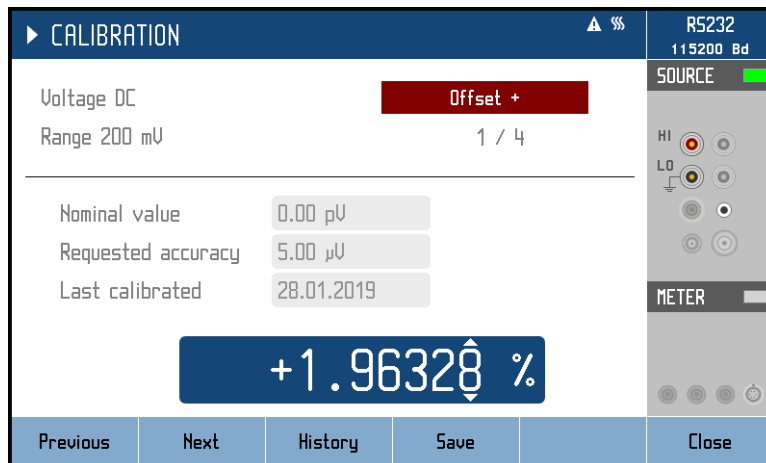


Figure 43 Calibration point adjustment - direct

Displayed information show function and range selected for calibration in first two upper lines. Lower part of the display shows:

- Nominal value
- Requested accuracy of used calibration standard
- Last calibration date of this point
- Calibration value (only this can be modified)

History of each calibration point can be recalled using History softkey. History shows all previously saved values in a table, including date and relative drift from the first value ever recorded.

6.2. Calibration point adjustment

Two different approaches to calibration value adjustment are applied in 9010:

- Values denoted in % or without any unit (mostly used in source functions with continuous ranges like V_{dc} function in fig. 42 above) show relative position within selected range. Such points can be adjusted by changing the value so that the standard readout gets as close to nominal value as possible.
- Values with other units (mostly used in meter functions or fixed source standards) can be calibrated indirectly by typing in meter readout. Figure 43 below shows an example of 100Ω point of fixed resistance function which has been adjusted by measuring resistance on output terminals with standard meter and typing in the standard readout (99.9955Ω)

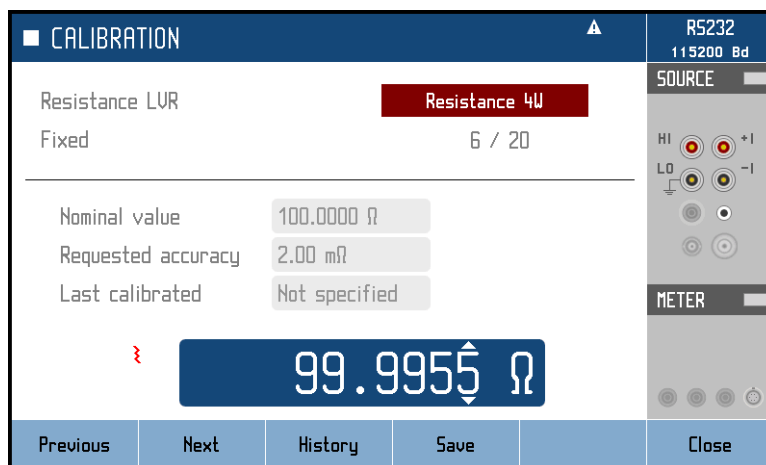


Figure 44 Calibration point adjustment - indirect

In both cases the procedure starts by connecting required standard to relevant terminals as shown on the right side of display. Meter functions measure all the time, source functions have to be switched on first using OPER key. Then adjust the main value accordingly and confirm with SAVE softkey.

HISTORY softkey allows you to check all previous values of this specific calibration point, PREVIOUS and NEXT softkeys navigate through other calibration points in selected range.

It is strongly recommended to periodically adjust all calibration points at once and in order as described in chapter 6.3 in order to maintain instrument specifications. That said, the instrument can be also adjusted partially, i.e. in particular functions or ranges only. If adjustment of next calibration point is not possible (f.e. when required standard is not available), the point can be skipped and old calibration data can be confirmed. However, specification can no longer be guaranteed in that range or function.

6.3. List of calibration points

Process of adjustment mostly involves changing offsets and slopes of individual ranges and other factors like amplitude linearity or frequency flatness coefficients of SCO option functions.

6.3.1. Voltage and current DC functions

Function	Range	Nominal value			
		Offset +	Offset -	Full range +	Full range -
Voltage DC	20 mV pas.	0.000 mV	0.000 mV	+19.000 mV	-19.000 mV
	200 mV pas.	0.000 mV	0.000 mV	+190.000 mV	-190.000 mV
	20 mV	0.000 mV	0.000 mV	+19.000 mV	-19.000 mV
	200 mV	0.000 mV	0.000 mV	+190.000 mV	-190.000 mV
	2 V	0.000 000 V	0.000 000 V	+1.900 000 V	-1.900 000 V
	20 V	0.000 00 V	0.000 00 V	+19.000 00 V	-19.000 00 V
	100 V	0.000 0 V	0.000 0 V	+100.000 0 V	-100.000 0 V
	280 V	+190.000 0 V	-190.000 0 V	+280.000 0 V	-280.000 0 V
	1000 V	0.000 0 V	0.000 0 V	+750.000 0 V	-750.000 0 V
Voltage from Current	50 mV	-	-	50.0 mV	-
	500 mV	-	-	500 mV	-
	5 V	-	-	5.00 V	-
Current DC	200 μ A	0.000 μ A	0.000 μ A	+190.000 μ A	-190.000 μ A
	2 mA	0.000 00 mA	0.000 00 mA	+1.900 00 mA	-1.900 00 mA
	20 mA	0.000 0 mA	0.000 0 mA	+19.000 0 mA	-19.000 0 mA
	200 mA	0.000 mA	0.000 mA	+190.000 mA	-190.000 mA
	2 A	0.000 00 A	0.000 00 A	+1.900 00 A	-1.900 00 A
	20 A	0.000 0 A	0.000 0 A	+19.000 0 A	-19.000 0 A

Table 6 Calibration points – DC voltage and current

6.3.2. Voltage and current AC functions

Function	Range	Nominal value	
		Offset 1 kHz	Full 1 kHz
Voltage AC	20 mV	1.900 mV	19.000 mV
	200 mV	19.000 mV	190.000 mV
	2 V	0.190 00 V	1.900 00 V
	20 V	1.900 0 V	19.000 0 V
	100 V	19.000 V	100.000 V
	280 V	70.000 V	280.000 V
	1000 V	190.000 V	750.000 V
Voltage Harmonic	20 mV	1.9 mV	19.0 mV
	200 mV	19.0 mV	190 mV
	2 V	190 mV	1.90 V
	20 V	1.90 V	19.0 V
	100 V	19.0 V	100 V
	280 V	100 V	280 V
	1000 V	280 V	750 V
Current AC	200 µA	19.000 µA	190.000 µA
	2 mA	0.190 00 mA	1.900 00 mA
	20 mA	1.900 0 mA	19.000 0 mA
	200 mA	190.00 mA	190.000 mA
	2 A	0.190 00 A	1.900 00 A
	20 A	1.900 0 A	19.000 0 A
Current Harmonic	200 µA	19.0 µA	190 µA
	2 mA	190 µA	1.9 mA
	20 mA	1.9 mA	19 mA
	200 mA	19 mA	190 mA
	2 A	190 mA	1.9 A
	20 A	1.9 A	19 A

Table 7 Calibration points – AC voltage and current

6.3.3. Resistance functions

Range	Fixed	Nominal		Extended	
		Offset	Full range	Offset	Full range
0 Ω	0 Ω	-	-	-	-
10 Ω	10 Ω	-	10 Ω	-	10 Ω
100 Ω	100 Ω	33 Ω	100 Ω	33 Ω	100 Ω
1 k Ω	1 k Ω	330 Ω	1 k Ω	330 Ω	1 k Ω
10 k Ω	10 k Ω	3.3 k Ω	10 k Ω	3.3 k Ω	10 k Ω
100 k Ω	100 k Ω	33 k Ω	100 k Ω	33 k Ω	100 k Ω
1 M Ω	1 M Ω	330 k Ω	1 M Ω	330 k Ω	1 M Ω
10 M Ω	10 M Ω	3.3 M Ω	10 M Ω	3.3 M Ω	10 M Ω
100 M Ω	100 M Ω	33 M Ω	100 M Ω	33 M Ω	100 M Ω
1000 M Ω	1000 M Ω	330 M Ω	-	330 M Ω	1000 M Ω

Measured in 4W up to 100 k Ω and in 2W from 330 k Ω up.

Table 8 Calibration points – Resistance

6.3.4. Capacitance functions

Range	Fixed	Nominal		Extended	
		Offset	Full range	Offset	Full range
1nF	1 nF	0.5 nF	1 nF	0.5 nF	1 nF
10 nF	10 nF	3.3 nF	10 nF	3.3 nF	10 nF
100 nF	100 nF	33 nF	100 nF	33 nF	100 nF
1 μ F	1 μ F	330 nF	1 μ F	330 nF	1 μ F
10 μ F	10 μ F	3.3 μ F	10 μ F	3.3 μ F	10 μ F
100 μ F	100 μ F	33 μ F	100 μ F	33 μ F	100 μ F
1 mF	-	-	-	-	1 mF
10 mF	-	-	-	1.1 mF	9 mF
100 mF	-	-	-	11 mF	90 mF

Measured at 1 kHz up to 33 nF, at 120 Hz between 100 nF and 100 μ F. Values from 1 mF up are measured using ramp method.

Table 9 Calibration points – Capacitance

6.3.5. HVR option

Range	Nominal values
100 k Ω	50 Ω , 100 Ω , 200 Ω , 400 Ω , 800 Ω , 1.5 k Ω , 3 k Ω , 6 k Ω , 11.5 k Ω , 22.5 k Ω , 44 Ω , 86.2 k Ω
1 M Ω	168 k Ω , 328 k Ω , 640 k Ω
10 M Ω	1.25 M Ω , 2.45 M Ω , 4.78 M Ω , 9.36 M Ω
100 M Ω	18.2 M Ω , 35.5 M Ω , 69.6 M Ω
1 G Ω	135 M Ω , 236 M Ω , 430 M Ω , 780 M Ω
10 G Ω	1.39 G Ω , 2.7 G Ω , 4.7 G Ω , 8.3 G Ω
100 G Ω fixed	100 G Ω

Table 10 Calibration points - HVR option

6.3.6. SCO option

SINE functions	Nominal values		
Amplitude linearity	0 dBm, +5 dBm, +15 dBm		
Attenuator	-5 dBm, -10 dBm, -20 dBm, -20 dBm		
Frequency response	0 dBm in all 7 calibration points between 1 and 400 MHz		
VOLTAGE functions	Range	Nominal value	
		Offset	Full range
Voltage DC	0.5 V	0 mV	500 mV
	10 V	0 mV	10 V

Table 11 Calibration points - SCO option

6.3.7. MER option

Function	Range	Nominal value		
		Offset	Full range +	Full range -
Voltage DC	12 mV	0.000 mV	+10.000 mV	-10.000 mV
	120 mV	0.000 mV	+100.000 mV	-100.000 mV
	1.2 V	0.000 000 V	+1.000 000 V	-1.000 000 V
	12 V	0.000 00 V	+10.000 00 V	-10.000 00 V
Lo DC Current	100 μ A	0.000 μ A	100.000 μ A	-
	1 mA	0.000 0 mA	1.000 0 mA	-
Current DC	2.4 mA	0.000 0 mA	2.000 0 mA	-
	24 mA	0.000 0 mA	20.000 0 mA	-
Resistance	2 k Ω	0.000 00 k Ω	1.000 00 k Ω	-
	20 k Ω	0.000 0 k Ω	10.000 0 k Ω	-
Frequency	1 kHz	-	1.000 00 kHz	-
HVR option meter	1100 V (R<1M Ω)	0 V	900 V	-
	1500 V (R>1M Ω)	0 V	900 V	-

Table 12 Calibration points - MER option

7. Maintenance

This chapter explains how to perform the routine maintenance to keep your device in optimal operating conditions.

7.1. Fuse replacement

9010 calibrator has 2 user-replaceable fuses, both located on rear panel. Replace the fuses as follows:

1. Switch the calibrator off and disconnect power cord from it
2. Locate the fuse to be replaced: Mains fuse is in fuse/voltage selector case next to mains connector, current output fuse is in the middle of the rear panel.
3. Use flat screwdriver to either open voltage selector cover or turn current output fuse cover to get to the fuse holder.
4. Remove the fuse, check if it's blown and replace it with new fuse of the same rating if needed.

7.2. External surface cleaning

To keep the device in mint condition, clean the case and front panel keys using a soft cloth slightly dampened with either water or a non-abrasive mild cleaning solution that is not harmful to plastics.

7.3. Firmware update

Internal firmware can be updated by user. It is recommended check for firmware updates every 6 months or so to get the latest UI improvements, new features and bug fixes. To do this:

1. Go to www.meatest.com/drivers-updates and find firmware update file (.upl) for your device. If your device is not listed, contact Meatest support and ask for firmware update file for your device.
2. Check if the update file version is greater than yours, installed FW version can be found in MENU > Information > Software version. If the installed version is the same, stop the update process.
3. Download Uploader program from the same website and install it if you haven't already.
4. Connect the instrument to your PC using RS232 cable and use Uploader to update your instrument's firmware. The calibrator will be restarted once the update is finished.
5. Check installed FW version.

7.4. Error messages

Table 6 contains an overview of error codes that you might come across when operating the calibrator manually. Complete list of errors is available in SCPI manual.

Error code groups	Description and most notable error codes
1000-5999	Internal errors are detected by internal processors. Try updating internal firmware to the latest version as described in chapter 7.3 and if the error persists, please report this error to the Service Center.
6000-6999	User interface errors prevent the user from entering incorrect values from keyboard and accessing unavailable features. <u>6032</u> : Device is locked in remote control mode. Press "Go to Local" softkey to exit.
7000-7099	Errors caused by missing or damaged hardware. Restart the instrument and if the error persists, please report this error to the Service Center. <u>7021</u> : Source function is unavailable. Ask Meatest for possible upgrades. <u>7022</u> : Meter function is unavailable. Ask Meatest for MER option upgrade.
7100-7999	Protective element has been triggered and output/input has been shut off in order to prevent calibrator damage. Check for excessive load and/or external voltage at terminals. If the error persists, please report this error to the Service Center. <u>7100, 7101, 7103-7106, 7109, 7110</u> : Output overload. Decrease load to specified limits and/or disconnect external source of excessive voltage from output terminals. <u>7102, 7107, 7108</u> : Input overload. Decrease test signal voltage/current. <u>7111</u> : I+, I- terminals are open. Current output has been disconnected. <u>7112</u> : Hi-Lo terminals are shorted. Voltage output has been disconnected.
8000-8999	Calibration data errors can occur when working with calibration data. They also diagnose calibration backup errors.
9000-10999	Preset errors usually come up when trying to create, modify or delete a device or harmonic setup preset in a way which would corrupt preset data like reusing existing names, deleting actively used presets or exceeding memory capacity. See chapter 3.6 for more details.
11000-11999	Exceeding the limits of internal meters: The instrument contains a number of internal meters that monitor voltage and current limits at the terminals, the temperatures of some important parts of the device, and other meters. Some of these errors may disconnect the output terminals. <u>11007</u> : Hi-Lo terminals are shorted. Voltage output has been disconnected. <u>11008</u> : HVR voltage overload. HVR output has been disconnected. <u>11028</u> : I+, I- terminals are open. Current output has been disconnected.

Table 13 Error code overview

8. Specifications

All absolute uncertainty specifications in this document are defined at a confidence interval of 95%, extension coefficient $k = 2$. Uncertainties include 12 months long-term stability, temperature coefficient, linearity, load and line regulation and the traceability of factory and National calibration standards. Recommended recalibration interval is 1 year.

Temperature and humidity stabilization and additional 30-minute warm-up in reference conditions are required in order to reach these specifications.

Ambient conditions

Reference conditions:	+22 – +24 °C, max. 70% relative humidity
Operating conditions:	+13 – +33 °C, max. 70% relative humidity, max. altitude 3 km
Storage conditions:	-10 – +55 °C, max. altitude 12 km
Temperature coefficient:	10 % of specifications per °C outside T_{ref}

General

Warm-up time:	30 minutes
Power supply:	115/230 V \pm 10 % – 50/60 Hz, 450 VA max.
EMC compliance:	Safety class I according to IEC 61010 ed. 2 ESD class I according to EN 61326 Overvoltage CAT II Pollution Degree 2
Dimensions (W x H x D):	435 x 175 x 620 mm
Weight:	23 kg

8.1. Voltage

DCV range summary:	0.00000 mV – 1050.000 V	
ACV range summary:	1.00000 mV _{rms} – 1050.000 V _{rms}	
Voltage ranges:	auto, 20 mV, 200 mV, 2 V, 20 V, 100 V, 280 V, 1050 V	
Range limits:	150 – 1050 V for 1050V range, 5 – 100 % of range otherwise	
Available AC units:	RMS, peak, peak-peak, average	
Frequency range:	15.000 Hz – 300.00 kHz	below 2 V
	15.000 Hz – 100.000 kHz	for 2 V – 20 V
	15.000 Hz – 30.000 kHz	for 20 V – 200 V
	15.000 Hz – 10.0000 kHz	for 200 V – 280 V
	20.000 Hz – 1000.00 Hz	above 280 V
Frequency uncertainty:	25 ppm	
Voltage output modes:	passive 50Ω output, available in DC up to 200 mV	
	active output, available in entire range of both DC and AC	

DCV Absolute Uncertainty [ppm]

Range	90 days	1 year
0.00000 – 20.00000 mV	180 + 20 μV / 180 + 3 μV ¹	220 + 20 μV / 220 + 3 μV ¹
20.00001 – 200.00000 mV	40 + 20 μV / 40 + 3 μV ¹	45 + 20 μV / 45 + 3 μV ¹
0.2000001 – 2.0000000 V	28 + 10 μV	35 + 10 μV
2.000001 – 20.000000 V	28 + 40 μV	35 + 40 μV
20.00001 – 100.00000 V	35 + 250 μV	42 + 250 μV
100.00001 – 280.00000 V	35 + 500 μV	42 + 500 μV
280.0001 – 1050.000 V	42 + 7 mV	50 + 7 mV

1. In passive output mode.

ACV Absolute Uncertainty [ppm]

Range	15 Hz – 10 kHz		10 kHz – 30 kHz		30 kHz – 100 kHz		100 kHz – 300 kHz	
	90 days	1 year	90 days	1 year	90 days	1 year	90 days	1 year
1.0000 – 20.0000 mV	1600 + 30 μV	2000 + 30 μV	1600 + 40 μV	2000 + 40 μV	9500 + 100 μV	10000 + 100 μV	45000 + 900 μV	50000 + 900 μV
20.0000 – 200.0000 mV	850 + 80 μV	1000 + 80 μV	1200 + 120 μV	1500 + 120 μV	2800 + 300 μV	3000 + 300 μV	4600 + 1 mV	5000 + 1 mV
0.200000 – 2.000000 V	210 + 120 μV	250 + 120 μV	420 + 300 μV	500 + 300 μV	1800 + 1 mV	2000 + 1 mV	4600 + 1 mV	5000 + 1 mV
2.000000 – 20.000000 V	210 + 700 μV	250 + 700 μV	420 + 1.5 mV	500 + 1.5 mV	1800 + 10 mV	2000 + 10 mV	N/A	N/A
20.00001 – 100.00000 V	250 + 5 mV	270 + 5 mV	420 + 15 mV	500 + 15 mV	N/A	N/A	N/A	N/A
100.00001 – 280.00000 V ²	260 + 12 mV	300 + 12 mV	420 + 50 mV	500 + 50 mV	N/A	N/A	N/A	N/A
280.000 – 1050.000 V ³	380 + 85 mV	420 + 85 mV	N/A	N/A	N/A	N/A	N/A	N/A

2. Frequency is limited to 15 – 10000 Hz above 200 V.

3. Frequency is limited to 20 – 1000 Hz.

Distortion and Load Characteristics

Parameter	Range	20mV	200mV	2V	20V	100 V	280V	1000V
THD + noise *4	15 – 45 Hz	0.05 % + 200 μ V	0.05 % + 300 μ V	0.15 %	0.15 %	0.15 %	0.15 %	0.25 %
	45 – 10000 Hz	0.05 % + 200 μ V	0.05 % + 300 μ V	0.05 %	0.05 %	0.05 %	0.05 %	0.20 %
	10 – 30 kHz	0.25 % + 200 μ V	0.25 % + 300 μ V	0.12 %	0.15 %	0.3 %	0.3 %	N/A
	30 – 100 kHz	0.35 % + 230 μ V	0.35 % + 300 μ V	0.22 %	0.3 %	N/A	N/A	N/A
	100 – 300 kHz	1.5 % + 500 μ V	1 % + 700 μ V	0.7 %	N/A	N/A	N/A	N/A
Burden current	DC active	1 mA	5 mA	30 mA	50 mA	50 mA	50 mA	5 mA
	45 – 10000 Hz	0.5 mA _{rms}	4 mA _{rms}	30 mA _{rms}	50 mA _{rms}	50 mA _{rms}	40 mA _{rms}	3 mA _{rms}
	10 – 30 kHz	0.5 mA _{rms}	4 mA _{rms}	10 mA _{rms}	10 mA _{rms}	10 mA _{rms}	10 mA _{rms}	N/A
	30 – 100 kHz	0.5 mA _{rms}	2 mA _{rms}	5 mA _{rms}	5 mA _{rms}	N/A	N/A	N/A
	100 – 300 kHz	100 Ω min. load	100 Ω min. load	1 mA	N/A	N/A	N/A	N/A

4. THD in bandwidth up to 500 kHz or 10 lowest harmonics.

Non-sinusoidal waveforms

Waveforms: symmetrical square, ramp up, ramp down, triangle, truncated sinus with THD 13.45 %, harmonics

Current range: 1.00000 mV_{rms} – 200.0000 V_{rms}

Frequency range: 15.000 – 1000.00 Hz

Peak value uncertainty: 0.3 % of range + 50 μ V_{rms}

8.2. Current

DCI range summary:	0.0000 μ A – 20.00000 A	
ACI range summary:	10.0000 μ A _{rms} – 20.00000 A _{rms}	
Current ranges:	auto, 200 μ A, 2 mA, 20 mA, 200 mA, 2 A, 20 A	
Range limits:	5 – 100 % of range	
Available AC units:	RMS, peak, peak-peak, average	
Frequency range:	15.000 Hz – 10.0000 kHz	below 200 mA
	15.000 Hz – 5.0000 kHz	for 200 mA – 2 A
	15.000 Hz – 1000.00 Hz	above 2 A
Frequency uncertainty:	25 ppm	

DCI Absolute Uncertainty [ppm]

Range	90 days	1 year
0.0000 – 200.0000 μ A	5000 + 20 nA	5000 + 20 nA
0.200000 – 2.000000 mA	280 + 100 nA	280 + 100 nA
2.00000 – 20.00000 mA	150 + 600 nA	150 + 600 nA
20.0000 – 200.0000 mA	150 + 6 μ A	150 + 6 μ A
0.200000 – 2.000000 A	200 + 130 μ A	200 + 130 μ A
2.00000 – 20.00000 A	250 + 2 mA	250 + 2 mA

ACI Absolute Uncertainty [ppm]

Range	15 Hz – 1 kHz		1 kHz – 5 kHz		5 kHz – 10 kHz	
	90 days	1 year	90 days	1 year	90 days	1 year
10.0000 – 200.0000 μ A	1300 + 150 nA	1500 + 150 nA	2600 + 200 nA	3000 + 200 nA	4600 + 500 nA	5000 + 500 nA
0.200000 – 2.000000 mA	800 + 300 nA	850 + 300 nA	1800 + 1 μ A	2000 + 1 μ A	4600 + 1.4 μ A	5000 + 1.4 μ A
2.00000 – 20.00000 mA	450 + 2 μ A	500 + 2 μ A	1800 + 10 μ A	2000 + 10 μ A	4600 + 14 μ A	5000 + 14 μ A
20.0000 – 200.0000 mA	450 + 20 μ A	500 + 20 μ A	1800 + 100 μ A	2000 + 100 μ A	4600 + 140 μ A	5000 + 140 μ A
0.200000 – 2.000000 A	620 + 200 μ A	700 + 200 μ A	1800 + 500 μ A	2000 + 500 μ A	N/A	N/A
2.00000 – 20.00000 A	850 + 6 mA	1000 + 6 mA	N/A	N/A	N/A	N/A

Distortion and Load Characteristics

Parameter	Range	200 μ A	2 mA	20 mA	200 mA	2 A	20 A
Max. inductive load	15 Hz – 10 kHz	1 H	100 mH	100 mH	10 mH	1 mH	500 μ H
THD + noise ⁵	15 Hz – 1 kHz	0.2 %	0.2 %	0.2 %	0.2 %	0.2 %	0.3 %
	1 kHz – 5 kHz	0.2 %	0.2 %	0.2 %	0.2 %	0.2 %	N/A
	5 kHz – 10 kHz	0.5 %	0.4 %	0.4 %	0.4 %	N/A	N/A
Compliance voltage	DC	5 V	5 V	10 V	10 V	5 V	5 V
	15 Hz – 1 kHz	4 V _{rms}	4 V _{rms}	5 V _{rms}	5 V _{rms}	3.5 V _{rms}	3 V _{rms}
	1 kHz – 5 kHz	4 V _{rms}	4 V _{rms}	5 V _{rms}	5 V _{rms}	3.5 V _{rms}	N/A
	5 kHz – 10 kHz	2 V _{rms}	2 V _{rms}	2 V _{rms}	2 V _{rms}	N/A	N/A
Load adder ⁶	15 Hz – 45 Hz	50 nA/V	50 nA/V	50 nA/V	100 nA/V	100 μ A/V	500 μ A/V
	45 Hz – 1 kHz	70 nA/V	70 nA/V	70 nA/V	100 nA/V	100 μ A/V	500 μ A/V
	1 kHz – 5 kHz	1.5 μ A/V	1.5 μ A/V	1.5 μ A/V	2 μ A/V	200 μ A/V	1 mA/V
	5 kHz – 10 kHz	2 μ A/V	2 μ A/V	2 μ A/V	3 μ A/V	600 μ A/V	3 mA/V

5. THD in bandwidth up to 100 kHz

6. Additional uncertainty for compliance voltage above 0.5 V_{rms}

Non-sinusoidal waveforms

Waveforms: symmetrical square, ramp up, ramp down, triangle, truncated sinus with THD 13.45 %, harmonics

Current range: 100.0000 μ A_{rms} – 2.000000 A_{rms}

Frequency range: 15.000 – 1000.00 Hz

Peak value uncertainty: 0.3 % of range + 500 nA_{rms}

8.2.1. Voltage from current terminals

Voltage range I output: 5.00000 mV – 5.000000 V

Coefficient range: 0.000002 – 10.000000 V/A

Waveform: DC, sinusoidal

Frequency range: DC, 15.000 Hz – 400.00 Hz

Distortion: < 0.1 % in 100 kHz bandwidth

ACV from I output specifications

Range	Absolute uncertainty [ppm]	Source impedance
5.00000 – 50.00000 mV	500 + 20 μ V	2.2 Ω
50.0001 – 500.0000 mV	500 + 200 μ V	22 Ω
0.500000 – 5.000000 V	500 + 1 mV	220 Ω

8.2.2. Current coil (option 140-50)

Applicable multiplier: 2 – 200

Max. simulated current: multiplier · 20 A (1000 A with 140-50 Current Coil)

Frequency range: 45 – 65 Hz

Additional uncertainty: 0.25 %

8.3. Resistance

Measurement modes: 4W, 2W

8.3.1. Continuous range mode

Resistance range summary: 0.0000 Ω – 1.000000 M Ω in 4W mode

0.0000 Ω – 1.000000 G Ω in 2W mode

2W compensation: 0.0 – 1000.0 m Ω

Continuous resistance ranges, uncertainties and limits

Nominal range ⁷	4W uncertainty [ppm]		2W uncertainty [ppm]		Applicable test current
	90 days	1 year	90 days	1 year	
0.0000 – 10.0000 Ω	250 + 1 m Ω	300 + 1 m Ω	250 + 131 m Ω	300 + 131 m Ω	0.4 – 100 mA
10.0001 – 33.0000 Ω	210 + 1 m Ω	250 + 1 m Ω	210 + 131 m Ω	250 + 131 m Ω	0.4 – 100 mA
33.0001 – 100.0000 Ω	120 + 1 m Ω	150 + 1 m Ω	120 + 131 m Ω	150 + 131 m Ω	0.4 – 100 mA
100.0001 – 200.0000 Ω	85 + 3 m Ω	100 + 3 m Ω	85 + 133 m Ω	100 + 133 m Ω	0.4 – 30 mA
200.001 – 1000.000 Ω	85 + 3 m Ω	100 + 3 m Ω	85 + 133 m Ω	100 + 133 m Ω	0.4 – 10 mA
1000.001 – 2000.000 Ω	85 + 30 m Ω	100 + 30 m Ω	85 + 160 m Ω	100 + 160 m Ω	0.1 – 6 mA
2.00001 – 10.00000 k Ω	85 + 30 m Ω	100 + 30 m Ω	85 + 160 m Ω	100 + 160 m Ω	20 – 2000 μ A
10.00001 – 20.00000 k Ω	85 + 300 m Ω	100 + 300 m Ω	85 + 430 m Ω	100 + 430 m Ω	4 – 1000 μ A
20.0001 – 100.0000 k Ω	85 + 300 m Ω	100 + 300 m Ω	85 + 430 m Ω	100 + 430 m Ω	1 – 200 μ A
100.0001 – 200.0000 k Ω	85 + 3 Ω	100 + 3 Ω	85 + 3 Ω	100 + 3 Ω	1 – 100 μ A
200.001 – 330.000 k Ω	85 + 3 Ω	100 + 3 Ω	85 + 3 Ω	100 + 3 Ω	1 – 60 μ A
330.001 – 1000.000 k Ω	120 + 3 Ω	150 + 3 Ω	120 + 3 Ω	150 + 3 Ω	0.2 – 20 μ A
1000.001 – 2000.000 k Ω			120 + 30 Ω	150 + 30 Ω	0.04 – 10 μ A
2.00001 – 3.30000 M Ω			120 + 30 Ω	150 + 30 Ω	0.04 – 6 μ A
3.30001 – 10.00000 M Ω			160 + 30 Ω	200 + 30 Ω	10 – 2000 nA
10.00001 – 20.00000 M Ω			850 + 300 Ω	1000 + 300 Ω	10 – 1000 nA
20.0001 – 33.0000 M Ω			850 + 300 Ω	1000 + 300 Ω	10 – 600 nA
33.0001 – 100.0000 M Ω			1600 + 300 Ω	2000 + 300 Ω	10 – 180 nA
100.0001 – 200.0000 M Ω			2500 + 300 Ω	3000 + 300 Ω	10 – 100 nA
200.001 – 330.000 M Ω			2500 + 300 Ω	3000 + 300 Ω	10 – 60 nA
330.001 – 1000.000 M Ω			6200 + 1 k Ω	7000 + 1 k Ω	4 – 20 nA

7. Range boundaries are based on calibration values of fixed resistance mode standards and as such may deviate from nominal values by up to 5%.

8.3.2. Fixed resistance mode

Resistance range summary: 0.0000 Ω – 100.0000 k Ω in 4W mode
0.0000 Ω – 1.000000 G Ω in 2W mode

Fixed resistance uncertainties

Nominal value	Calibration value uncertainty		Tolerance from nominal		Maximum load
	4W	2W	4W	2W	
0.0000 Ω	< 0.2 m Ω	0.2 Ω	± 10 m Ω	± 1 Ω	500 mA _{pk}
1.0000 Ω	200 ppm	5 %	± 2 %	± 1 Ω	400 mA _{pk}
10.0000 Ω	20 ppm	0.5 %	± 2 %	± 1 Ω	300 mA _{pk}
100.0000 Ω	15 ppm	150 ppm	± 2 %	± 2 %	100 mA _{pk}
1000.000 Ω	15 ppm	15 ppm	± 2 %	± 2 %	20 V _{pk}
10.00000 k Ω	15 ppm	15 ppm	± 2 %	± 2 %	20 V _{pk}
100.0000 k Ω	15 ppm	15 ppm	± 2 %	± 2 %	100 V _{pk}
1000.000 k Ω	-	30 ppm	-	± 2 %	100 V _{pk}
10.00000 M Ω	-	500 ppm	-	± 5 %	100 V _{pk}
100.0000 M Ω	-	0.1 %	-	± 10 %	100 V _{pk}
1000.000 M Ω	-	0.25 %	-	± 15 %	100 V _{pk}

8.3.3. HVR high voltage resistance option

Resistance range summary: 100.00 k Ω – 10.000 G Ω continuous, 100 G Ω fixed standard

Test voltage measurement: 0.0 – 1500.0 V_{dc}

Resistance ranges and uncertainties

Range	Max. test voltage	Resistance uncertainty	Test voltage measurement uncertainty
100.00 – 199.99 k Ω	800 V _{dc}	0.2 %	0.3 % + 2 V
200.0 – 999.9 k Ω	1100 V _{dc}	0.2 %	0.3 % + 2 V
1.0000 – 1.9999 M Ω	1150 V _{dc}	0.3 %	0.5 % + 5 V
2.000 – 9.999 M Ω	1150 V _{dc}	0.3 %	0.5 % + 5 V
10.000 – 19.999 M Ω	1500 V _{dc}	0.5 %	0.5 % + 5 V
20.00 – 199.99 M Ω	1500 V _{dc}	0.5 %	0.5 % + 5 V
200.0 – 999.9 M Ω	1500 V _{dc}	0.5 %	0.5 % + 5 V
1.0000 – 1.9999 G Ω	1500 V _{dc}	1 %	1 % + 5 V
2.000 – 10.000 G Ω	1500 V _{dc}	1 %	1 % + 5 V
100 G Ω	1500 V _{dc}	3 %	1.5 % + 5 V

8.4. Capacitance

Measurement modes: 2W

8.4.1. Continuous range mode

Range summary: 0.800000 nF – 120.0000 mF

Capacitance ranges, loads and uncertainties

Range	Uncertainty		Max. test frequency	Maximum load ^{*8}
	90 days	1 year		
0.800000 – 2.000000 nF	0.5 % + 15 pF	0.5 % + 15 pF	1000 Hz	2 – 5 V _{rms}
2.00001 – 3.30000 nF	0.5 % + 15 pF	0.5 % + 15 pF	1000 Hz	2 – 5 V _{rms}
3.30001 – 20.00000 nF	0.45 %	0.5 %	1000 Hz	2 – 5 V _{rms}
20.0001 – 33.0000 nF	0.45 %	0.5 %	1000 Hz	2 – 5 V _{rms}
33.0001 – 100.0000 nF	0.45 %	0.5 %	500 Hz	2 – 5 V _{rms}
100.0001 – 200.0000 nF	0.45 %	0.5 %	300 Hz	2 – 5 V _{rms}
0.200001 – 2.000000 µF	0.45 %	0.5 %	300 Hz	2 – 5 V _{rms}
2.00001 – 3.30000 µF	0.45 %	0.5 %	300 Hz	2 – 5 V _{rms}
3.30001 – 10.00000 µF	0.45 %	0.5 %	300 Hz	100 mA _{rms}
10.00001 – 20.00000 µF	1.3 %	1.5 %	300 Hz	100 mA _{rms}
20.0001 – 33.0000 µF	1.3 %	1.5 %	300 Hz	100 mA _{rms}
33.0001 – 100.0000 µF	2.2 %	2.5 %	300 Hz	100 mA _{rms}
100.0001 – 200.0000 µF	2.5 %	3 %	70 Hz	100 mA _{rms}
0.200001 – 1.000000 mF	2.5 %	3 %	70 Hz	100 mA _{rms}
1.000001 – 2.000000 mF	4.5 %	5 %	20 Hz	100 mA _{rms}
2.00001 – 10.00000 mF	4.5 %	5 %	20 Hz	100 mA _{rms}
10.00001 – 20.00000 mF	4.5 %	5 %	5 Hz	100 mA _{rms}
20.0001 – 120.0000 mF	4.5 %	5 %	5 Hz	100 mA _{rms}

8. Voltage limit depends on test frequency, current should never exceed 100 mA_{rms}.

8.4.2. Fixed capacitance mode

Range summary: 1.000000 nF – 100.0000 µF

Tolerance from nominal: ± 10 %

Capacitance uncertainties

Nominal value	Calibration value unc.	Max. test frequency	Maximum load
1.000000 nF	2.5 %	1000 Hz	5 V _{rms}
10.00000 nF	0.35 %	1000 Hz	5 V _{rms}
100.0000 nF	0.25 %	500 Hz	5 V _{rms}
1.000000 µF	0.25 %	300 Hz	5 V _{rms}
10.00000 µF	0.35 %	300 Hz	100 mA _{rms}
100.0000 µF	0.8 %	300 Hz	100 mA _{rms}

8.5. Power and energy

Voltage range summary:	0.200000 V – 280.0000 V
Current range summary:	0.200000 mA – 20.00000 A, time-limited above 10 A
Electric power range:	0.04000 mW – 5.6000 kW
Frequency range:	DC, 15.000 Hz – 1000.00 Hz
Energy period range:	10 s – 1999 s
Phase shift range:	0.00° – 359.99°
Phase shift uncertainty:	0.15° below 200 Hz 0.25° above 200 Hz

8.5.1. DC power

Uncertainty of DC power is determined by formula $dP = \sqrt{(dU^2 + dI^2 + 0.01^2)}$, where:

- dP is uncertainty of output power in %
- dU is uncertainty of set voltage in %, as per DCV specifications in chapter 8.1
- dI is uncertainty of set current in %, as per DCI specifications in chapter 8.2

DC power calculation example

This example calculates uncertainty of 4 W (20 V, 200 mA). Individual items in formula are calculated like this:

- $dU = 0.0035\% + 40\text{ }\mu\text{V} = 0.0037\%$ of 20 V value
- $dI = 0.015\% + 6\text{ }\mu\text{A} = 0.018\%$ of 200 mA value

DC power uncertainty is then calculated as $dP = \sqrt{(0.0037^2 + 0.018^2 + 0.01^2)} = 0.021\%$, which is also the best DC accuracy achievable.

8.5.2. AC power

Uncertainty of AC power is determined by formula $dP = \sqrt{(dU^2 + dI^2 + dPF^2 + 0.03^2)}$, where:

- dP is uncertainty of output power in %
- dU is uncertainty of set voltage in %, as per ACV specifications in chapter 8.1
- dI is uncertainty of set current in %, as per ACI specifications in chapter 8.2
- dPF is uncertainty of power factor in %

dPF is based on type of power units used, calculated by following formulas:

- $dPF = [1 - \cos(\varphi + d\varphi) / \cos(\varphi)] \cdot 100$ for active power
- $dPF = [1 - \sin(\varphi + d\varphi) / \sin(\varphi)] \cdot 100$ for reactive power
- $dPF = 0$ for apparent power

where:

- φ is set phase shift between voltage and current
- $d\varphi$ is uncertainty of set phase shift

AC power calculation example

This example is based on following parameters:

- Function: AC active power
- Set value: 500 W (100 V, 10 A, 60° phase shift), 50 Hz

Individual items in formula are then calculated like this:

- $dU = 0.025 \% + 0.010 \% \text{ of range} = 0.045 \% \text{ of } 100 \text{ V value}$
- $dI = 0.05 \% + 0.01 \% \text{ of range} = 0.06 \% \text{ of } 10 \text{ A value}$
- $dPF = [1 - \cos (60 + 0.15) / \cos 60] \cdot 100 = 0.45 \%$

AC power uncertainty is then calculated as $dP = \sqrt{(0.045^2 + 0.06^2 + 0.45^2 + 0.03^2)} = 0.46 \%$

Standalone Power Factor (PF) specifications

Range: -1.0000 – +1.0000

Uncertainty is determined by formula $dPF = \text{abs} [\cos (\varphi + d\varphi) / \cos (\varphi)] + 0.0005$, where:

- φ is set phase shift between voltage and current
- $d\varphi$ is uncertainty of set phase shift

8.5.3. DC and AC electric energy

Electric energy uncertainties are determined by the same formulas as power with addition of time period uncertainty of 0.01 % + 0.3 s. Final formulas are therefore:

- $dE = \sqrt{(dU^2 + dI^2 + dt^2 + 0.01^2)}$ for DC
- $dE = \sqrt{(dU^2 + dI^2 + dPF^2 + dt^2 + 0.03^2)}$ for AC

where dt is calculated as $0.01 + 30/\text{set period}$.

AC energy calculation example

This example is based on following parameters:

- Function: AC energy
- Set power: 460 W (230 V, 2 A, 0° phase shift), 50 Hz
- Set period: 5 minutes

Individual items in formula are then calculated like this:

- $dU = 0.03 \% + 12 \text{ mV} = 0.035 \% \text{ of } 230 \text{ V value}$
- $dI = 0.07 \% + 200 \mu\text{A} = 0.08 \% \text{ of } 2 \text{ A value}$
- $dPF = [1 - \cos (0 + 0.15) / \cos 0] \cdot 100 = 0.0003 \%$
- $dt = 0.01 \% + 0.3 \text{ s} = 0.11 \% \text{ of } 5 \text{ minute period}$

AC energy uncertainty is then calculated as $dE = \sqrt{(0.035^2 + 0.08^2 + 0.0003^2 + 0.11^2 + 0.03^2)} = 0.14 \%$

8.6. Harmonics

Harmonic products may be added in all AC functions of the calibrator (voltage, current, power, energy).

Fundamental signal specifications changes

Max. amplitude:	200 V _{rms} and 2 A _{rms}
Min. amplitude uncertainty:	0.2 % of range
Max. frequency:	1 kHz
Min. frequency uncertainty:	25 ppm
V-from-I phase uncertainty:	0.2° below 70 Hz 0.5° above 70 Hz

Harmonic product specifications

Number of products:	50
Amplitude range:	0.00 – 30.00 %
Max. frequency:	5 kHz
Phase shift range:	0.00 – 360.00 °
Phase shift uncertainty:	5 μs (typical)

8.7. Temperature sensor simulation

Sensor types: RTDs, thermocouples

8.7.1. RTD resistance temperature sensor simulation

Temperature range summary: -200.00 °C – 800.00 °C

Temperature scales: Pt 3850 IPTS68, Pt 3851 ITS90, Pt 3916, Pt 3926, Ni 120, custom

Range of R0 setting: 20 – 2000 Ω

Ranges and uncertainties of RTD sensor simulation [°C]

Type	Temperature range						
	-200 – -190	-190 – -100	-100 – 0	0 – 250	250 – 460	460 – 630	630 – 800
Pt3850 R0: 100 Ω	0.05	0.06	0.07	0.09	0.12	0.14	0.18
Pt3851 R0: 100 Ω	0.05	0.06	0.08	0.10	0.12	0.15	0.18
Pt3926 R0: 100 Ω	0.06	0.06	0.08	0.10	0.12	0.15	
Pt3916 R0: 100 Ω	0.06	0.06	0.08	0.10	0.12	0.15	
Pt385 R0: 200 Ω	0.04	0.05	0.08	0.09	0.12	0.14	
Pt385 R0: 500 Ω	0.04	0.04	0.05	0.08	0.12	0.15	
Pt385 R0: 1000 Ω	0.03	0.04	0.05	0.09	0.11	0.14	
Type	-80 – 0	0 – 100	100 – 260				
Ni 120	0.05	0.08	0.14				

8.7.2. Thermocouple Temperature Sensor Simulation

Temperature range summary: -250.00 – 2315.00 °C (by sensor type)

Thermocouple types: B, C, D, E, G2, J, K, M, N, R, S, T

Cold junction comp. modes: off, manual, automatic ^{*9}

9. MER option and Adapter 91 are required. Adds 0.3 °C uncertainty of Adapter 91.

Ranges and uncertainties of TC sensor simulation [°C]

R	range	-50 – 100	100 – 400	400 – 1000	1000 – 1767
	uncertainty	0.96	0.55	0.44	0.39
S	range	-50 – 100	100 – 250	250 – 1400	1400 – 1767
	uncertainty	0.90	0.56	0.49	0.40
B	range	400 – 800	800 – 1000	1000 – 1500	1500 – 1820
	uncertainty	0.90	0.54	0.48	0.41
J	range	-210 – -100	-100 – 150	150 – 700	700 – 1200
	uncertainty	0.30	0.25	0.18	0.18
T	range	-200 – -100	-100 – 0	0 – 100	100 – 400
	uncertainty	0.30	0.26	0.21	0.18
E	range	-250 – -100	-100 – 280	280 – 600	600 – 1000
	uncertainty	0.45	0.23	0.19	0.19
K	range	-200 – -100	-100 – 480	480 – 1000	1000 – 1372
	uncertainty	0.35	0.25	0.23	0.24
N	range	-200 – -100	-100 – 0	0 – 580	580 – 1300
	uncertainty	0.45	0.30	0.26	0.23
M	range	-50 – 50	50 – 100	100 – 470	470 – 1410
	uncertainty	0.25	0.22	0.21	0.20
C	range	0 – 100	100 – 280	280 – 1370	1370 – 2315
	uncertainty	0.37	0.34	0.34	0.47
D	range	0 – 100	100 – 280	280 – 1830	1830 – 2315
	uncertainty	0.45	0.37	0.34	0.47
G₂	range	100 – 200	200 – 430	430 – 2080	2080 – 2315
	uncertainty	0.72	0.49	0.35	0.39

8.8. SCO 400 MHz scope option

Scope option function overview

Function	Frequency range	Voltage range	Output terminals	Nominal output impedance
Voltage LF Low Mode	DC, 0.1 Hz – 100 kHz	0 – 10.5 V _{pk}	N connector	50 Ω
Voltage LF High Mode	DC, 15 Hz – 1 kHz	0 – 200 V _{pk}	HI – LO output terminals	0 Ω
SINE mode (levelled)	15 Hz – 400 MHz	1.4 mV _{pk} – 1.5 V _{pk}	N connector	50 Ω
Pulse Width Mode (PWM)	0.1 Hz – 400 MHz	50 mV _{pk} – 1 V _{pk}	N connector	50 Ω
Time Marker Mode	0.1 Hz – 400 MHz	50 mV _{pk} – 1 V _{pk}	N connector	50 Ω

Trigger output

Waveform: positive square wave
 Amplitude: $> 1 V_{pk} / 50 \Omega$
 Division ratio: off, 1, 10, 100
 Rise time: $< 1 \text{ ns}$

8.8.1. Voltage LF low mode

Output terminal: coaxial N connector
 Waveforms: DC (positive, negative), square wave (symmetrical, positive, negative)
 Frequency range: 0.100000 Hz – 100.0000 kHz
 Frequency uncertainty: 25 ppm
 Duty cycle range: 1.00 – 99.00 %
 Amplitude range: DC: 0.000 mV – 10.500 V
 Square wave: 1.000 mV_{pk} – 10.500 V_{pk}
 Amplitude uncertainty: 0.1 % + 50 μV below 10 kHz
 0.2 % + 50 μV above 10 kHz
 Max. load current: 20 mA (1 V_{pk} at 50Ω load)
 Rise time: $< 200 \text{ ns}$

8.8.2. Voltage LF high mode

Output terminal: 4mm terminals HI – LO
 Waveforms: DC (positive, negative), symmetrical square wave
 Frequency range: 15.00000 – 1000.000 Hz
 Frequency uncertainty: 25 ppm
 Amplitude range: DC: 0.000 mV – 200.00 V
 Square wave: 1.000 mV_{pk} – 200.00 V_{pk}
 Amplitude uncertainty: DC: as per DCV specifications
 Square wave: 0.3 % + 50 μV
 Max. load current: as per ACV specifications

8.8.3. Sine mode (levelled)

Output terminal: coaxial N connector
Waveform: sinusoidal
Frequency range: 15.00000 Hz – 400.00 MHz
Amplitude range: 1.400 mV_{pk} – 1.5000 V_{pk}

Parameters and uncertainties

Parameter	15 Hz – 100 kHz	100 – 500 kHz	0.5 – 10 MHz	10 – 100 MHz	100 – 400 MHz
Harmonic distortion	-55 dB	-38 dB (<10 dBm)	-38 dB (<10 dBm)	-38 dB (<10 dBm)	-30 dB (<10 dBm)
Flatness	< 0.2 %	< 0.5 %	< 1.2 %	< 2.0 %	< 2.5 %
Amplitude uncertainty	0.5 % + 350 μ V _{pk}	2.0 %	2.5 %	3.3 %	3.7 %

8.8.4. Pulse width mode (PWM)

Output terminal: coaxial N connector
Waveform: positive square wave
Frequency range: 0.100000 Hz – 400.000 MHz
Frequency uncertainty: 2.5 ppm
Pulse width range: 2.5 ns – 5 s
Duty cycle ratios: 1 %, 10 %, 20 %, 30 %, 40 %, 50 % below 2.5 MHz
10 %, 20 %, 30 %, 40 %, 50 % for 2.5 – 25 MHz
50 % above 25 MHz
Amplitude range: 50, 100, 500 and 1000 mV_{pk} / 50 Ω
Amplitude uncertainty: 5 %
Jitter: < 2 ns
Rise time: < 1 ns

8.8.5. Time marker mode

Output terminal: coaxial N connector
Waveform: 2 ns spike below 400 ns
PWM square wave above 400 ns
Time period range: 2.50000 ns – 10.000 s
Time period uncertainty: 2.5 ppm
Amplitudes: 50, 100, 500 and 1000 mV_{pk} / 50 Ω
Jitter: < 2 ns
Rise time: < 1 ns

8.9. MER integrated multimeter option

Functions:	DCV, DCI, frequency, resistance, TC, RTD	
Terminal ratings:	1700 V _{dc} / 1200 V _{ac} max	between V and COM
	250 V _{ac} max	between A and COM
	300 V _{ac} max	between COM and PE
	> 50 kΩ	between COM and PE

MER functions, ranges and absolute 1 year uncertainties

Function	Range	Uncertainty ¹⁰	Resolution / Range
DC voltage	± 12 mV	50 ppm + 3 μV	0.01 μV
	± 120 mV	50 ppm + 5 μV	0.1 μV
	± 1.2 V	50 ppm + 50 μV	1 μV
	± 12 V	50 ppm + 500 μV	10 μV
DC current	± 100 μA	0.02 % + 20 nA	1 nA
	± 1 mA	0.02 % + 100 nA	10 nA
	± 2.4 mA	150 ppm + 800 nA	100 nA
	± 24 mA	150 ppm + 800 nA	100 nA
Frequency	1 Hz – 100 kHz	50 ppm	10 μHz – 0.1 Hz
Resistance	2 kΩ	200 ppm + 10 mΩ	1 mΩ
	20 kΩ	200 ppm + 50 mΩ	10 mΩ

10. Excluding zero offset. Make zero correction to achieve described uncertainty.

8.9.1. RTD temperature measurement with 9000-60

Temperature range: -200.00 – 800.00 °C

Ranges and uncertainties of RTD sensor measurement [°C]

Type	Temperature range						
	-200 – -190	-190 – -100	-100 – 0	0 – 250	250 – 460	460 – 630	630 – 800
Pt3850 R ₀ : 100 Ω	0.10	0.12	0.14	0.18	0.24	0.28	0.36
Pt3851 R ₀ : 100 Ω	0.10	0.12	0.16	0.20	0.24	0.30	0.36
Pt3926 R ₀ : 100 Ω	0.12	0.12	0.16	0.20	0.24	0.30	
Pt3916 R ₀ : 100 Ω	0.12	0.12	0.16	0.20	0.24	0.30	
Pt385 R ₀ : 200 Ω	0.08	0.10	0.16	0.18	0.24	0.28	
Pt385 R ₀ : 500 Ω	0.08	0.08	0.10	0.16	0.24	0.30	
Pt385 R ₀ : 1000 Ω	0.08	0.08	0.10	0.18	0.22	0.28	
Type	-80 – 0	0 – 100	100 – 260				
Ni 120	0.15	0.24	0.42				

8.9.2. TC temperature measurement

Temperature range: -250.00 – 1820.00 °C

Cold junction comp. modes: Manual

Ranges and uncertainties of TC sensor measurement [°C]

R	range	-50 – 100	100 – 400	400 – 1000	1000 – 1767
	uncertainty	0.96	0.55	0.72	0.76
S	range	-50 – 100	100 – 250	250 – 1400	1400 – 1767
	uncertainty	0.91	0.56	0.79	0.79
B	range	400 – 800	800 – 1000	1000 – 1500	1500 – 1820
	uncertainty	0.89	0.54	0.48	0.81
J	range	-210 – -100	-100 – 150	150 – 700	700 – 1200
	uncertainty	0.31	0.22	0.29	0.29
T	range	-200 – -100	-100 – 0	0 – 100	100 – 400
	uncertainty	0.30	0.26	0.23	0.28
E	range	-250 – -100	-100 – 280	280 – 600	600 – 1000
	uncertainty	0.45	0.25	0.25	0.25
K	range	-200 – -100	-100 – 480	480 – 1000	1000 – 1372
	uncertainty	0.35	0.33	0.34	0.37
N	range	-200 – -100	-100 – 0	0 – 580	580 – 1300
	uncertainty	0.45	0.30	0.36	0.36
M	range	-50 – 50	50 – 100	100 – 470	470 – 1410
	uncertainty	0.25	0.22	0.32	0.32
C	range	0 – 100	100 – 280	280 – 1370	1370 – 2315
	uncertainty	0.37	0.34	0.61	0.96
D	range	0 – 100	100 – 280	280 – 1830	1830 – 2315
	uncertainty	0.46	0.38	0.63	0.94
G2	range	100 – 200	200 – 430	430 – 2080	2080 – 2315
	uncertainty	1.00	0.67	0.46	0.51



MEATEST, spol. s r. o., manufacturer of 9010 Multifunction Calibrator, based in Železná 3, 619 00 Brno, Czech Republic, declares that its product conforms to following specifications:

Safety requirements

- EN 61010-1 ed. 2:2011 + A1:2019

Electromagnetic compatibility

- EN 61000 part 3-2 ed. 4:2015 + Z1:2019
- EN 61000 part 3-3 ed. 3:2014 + A1:2019
- EN 61000 part 4-2 ed. 2:2009
- EN 61000 part 4-4 ed. 3:2013
- EN 61000 part 4-5 ed. 3:2015
- EN 61000 part 4-11 ed. 2:2005 + A1:2017

Brno

June 10th, 2020

Place

Date

A handwritten signature in blue ink, consisting of a stylized 'M' followed by a long horizontal stroke.

Signature